

## LATEST VEHICLE CONCERN FIXES



### Turbo Seized & P02CD stored in PCM

### 17-19MY F-PACE AJ20D

#### Customer Voice:

- CEL is on the Instrument Cluster. Vehicle is sluggish on acceleration and emits heavy exhaust at idle.

#### Technical Description:

- Turbo may be ingesting oil from impeller bearing failure or the impeller nut becoming dislodged. If all parts are not found, this can result in a second turbo replacement.

#### Status:

- Under Investigation
- Replace the turbo as required & find all missing pieces.
- Once turbo replacement is complete & test drive successful, run a new session file. Check for any stored DTCs. Prior to release of vehicle, check compression on all cylinders, ideally using PicoScope. If low compression is found with DTC P02CD stored, please raise a TA and follow LTS guidance. Otherwise, raise an EPQR with a picture of the part label on the replaced turbo. Hold onto the replaced parts.

