

Service Bulletin

July 4, 2019

Version 1

2016-17 HR-V: *Bluetooth*[®] HandsFreeLink[®] Will Freeze After Calls and Voice Tags are Missing at Startup

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016-17	HR-V	LX Only	ALL

SYMPTOM

Bluetooth[®] HandsFreeLink[®] (HFL) freezes after a phone call and stored voice tags are missing when the ignition is turned to ON.

POSSIBLE CAUSES

Some audio units are not updated to the latest software version.

CORRECTIVE ACTION

Update the audio unit software.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0100A1	Update the audio unit software.	0.3 hr	03214	03217	A19070A	39100-T7W-A81

Skill Level: Repair Technician

REPAIR PROCEDURE

NOTE

- Before updating the software, write down the customer's audio unit presets.
- Connect a fully charged battery jumper to the vehicle, and leave it connected during the entire procedure to maintain steady voltage.
- Apply the parking brake to keep the daytime running lights off during the update.

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

- 1. From your computer's desktop, open Honda Firmware Downloader. Refer to job aid *Honda Firmware Downloader* for additional information. Make sure that the USB flash drive tool is empty and formatted to FAT 32.
- 2. Enter the VIN. This is important as the software can be different depending on the model year level. Enter the service bulletin number, then select the download icon when the correct software is found.

NOTE


The software download may take up to **10-15 minutes** depending on the size of the file.



- 3. Once the download is complete, return to the vehicle.
- 4. Verify the software version. Download the update software to the vehicle's USB that will be used.

NOTE

If at any time during the update process a **TIMEOUT err** or **UNDEFINE err** message appears, check the USB flash drive for damage, or use a different one.

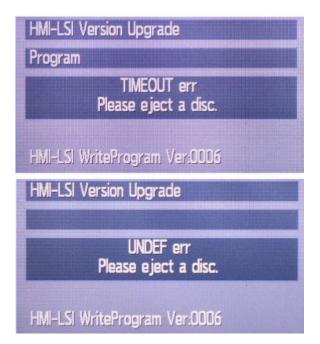

5. Turn the ignition to ON.

6. With the audio unit turned off, press the buttons in order as shown.



Press the buttons sequentially as shown.

This will let you view the Version display screen and verify the candidate software version is up-to-date.


Version display	
1 System ucom	5A23
2 HMI ucom	5023
3 DSP ucom	10D20201
4 Bluetooth module	HW02-SW03.29.02
6 BT Reflash	and the sea

If the software versions do not match the ones listed in the table below, do not update the audio unit because you can damage it.

Software Details	Valid Software Version	Valid Software Version	
Model Year	2016 HR-V	2017 HR-V	
System ucom	0054	A001	
HMI ucom	0054	AA01	
DSP ucom	10430206	10430207	
Bluetooth module	HW02-SW03.13.70	HW02-SW03.13.70	

7. Exit the **Version display** screen by pushing the Vol/Power button.

8. Set Audio Source to USB mode by pressing the MEDIA button.

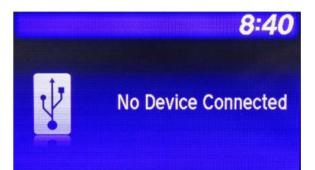

9. Update the audio unit software by plugging in the USB flash drive into the USB port. The audio unit will automatically detect the USB flash drive and start the update process.



NOTES

Never disconnect the battery, turn the ignition to OFF, disconnect the USB drive tool, or press the **BACK** button while the update is in progress.

You will see the following screens as the update runs:

DSP Vup



HMI-LSI Version

٠

HMI-LSI Version Upgrade				
Program				
55 %				
and the second s				
HMI-LSI WriteProgram Ver:0006				
HMI-LSI Version Upgrade				
Program				
completed				
HMI-LSI WriteProgram Ver:0006				

Sys Ver Up

٠



NOTE

The screen will go black, and the buttons will begin blinking. The blinking will speed up, you will hear a beep every 10% of progress.



• **Complete SW Ver**, You will hear a long beep, then the Honda logo will appear, and the audio unit will turn off when the software update is complete.



SOFTWARE UPDATE CONFIRMATION PROCEDURE

1. With the audio unit turned off, press the buttons in the order as shown.



Press the buttons sequentially as shown.


This will let you view the Version display screen and verify the software version was updated.

Version display	
1 System ucom	H001
2 HMI ucom	H001
3 DSP ucom	10D20201
4 Bluetooth module	HW02-SW03.29.02

Software Details	Updated Software Version		
Model Year	2016 HR-V	2017 HR-V	
System ucom	M054	AA01	
HMI ucom	0054	AA01	
DSP ucom	10430206	10430207	
Bluetooth module	HW02-SW03.13.70	HW02-SW03.13.70	

2. Press the VOL/Power button to exit the Version display screen.

- 3. Remove the USB flash drive.
- 4. Press and hold the VOL/Power button to sync the security code.

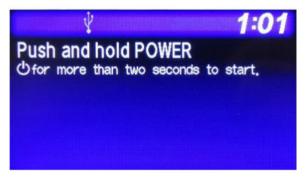

- 5. Set the clock to the correct time by selecting **MENU > Adjust Clock**.
- 6. Once the procedure is complete, restore customer audio unit presets, and have the service advisor tell the customer that any previously paired phones must to be paired again.

END