


Latest Vehicle Concern Fixes



Automatic Emergency Braking Not Available in Instrument Pack	18MY – 20MY E-PACE, F-PACE, I-PACE, F-TYPE, XE, XF, XJ, Range Rover, RR Sport, RR Velar, RR Evoque, Discovery, Discovery Sport
<p>Customer Voice:</p> <ul style="list-style-type: none">• Automatic Emergency Braking not available• Forward Alert not available• Emergency Lane Keeping not available <p>Technical Description:</p> <ul style="list-style-type: none">• Supplier manufacturing process error resulting in faulty hardware• DTC set in IPMA “U3000-96 – Component Internal Failure” <p>Status:</p> <ul style="list-style-type: none">• Supplier Permanent Corrective Action has been completed as of April 11th 2019• Clean stock of parts• Workshop Manual U3000-96 Help text will be altered to provide clear instructions to retailers• Pathfinder logic is currently being reviewed to implement replacement of module if serial number falls in the criteria	 <p>The image shows a close-up of a vehicle's instrument cluster. At the top, it displays '0 mph' and '69°F'. Below the speedometer, there is a large yellow 'i' in a circle, indicating an information or warning message. The text on the screen reads: 'OK to drive with caution Autonomous Emergency Braking not available'. At the bottom, it says 'Press OK to clear'. There are also icons for 'PARK', '3:24 PM', and a fuel gauge showing 7%.</p>

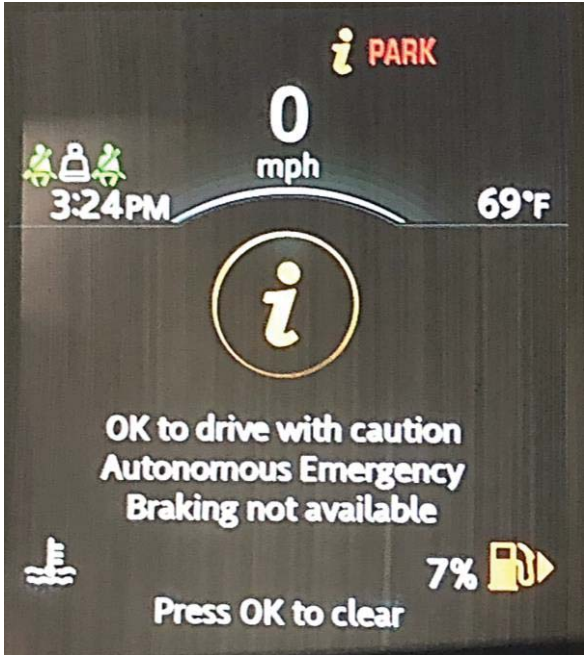