


Latest Vehicle Concern Fixes



Restricted Performance & Dynamic Stability Control Message	19MY I-PACE
<p>Customer Voice:</p> <ul style="list-style-type: none">• Restricted Performance with or without Dynamic Stability Control message on Instrument Cluster. <p>Technical Description:</p> <ul style="list-style-type: none">• This message may be paired with P0A2A, P0A2B, or P0A2D for Drive Motor “A” Temperature Sensor Circuit stored in either both or either EPIC B or C. <p>Status:</p> <ul style="list-style-type: none">• Under investigation• Follow TOPIx & Pathfinder Guided Diagnostics.• Inspect all the connectors at the EPIC and the EDU including the HV Cables. Inspect connectors for damaged & check to confirm there isn’t any coolant in the HV 3 phase connector at the EDU. Check Fuse 32 for rear inverter & Fuse 17 for front inverter.• Should parts be replaced, please raise an EPQR with the parts manager information	 <p>The image shows a yellow warning triangle with an exclamation mark inside, set against a dark background. Below the triangle, the text "Restricted Performance" is displayed in white.</p>

