



Technical Service Bulletin

01 MIL on, DTC P045600 and/or P044200, P04EF00, P04ED00 stored in the ECM

01 19 18 2055592/1 July 15, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3 e-tron	2015 - 2018	All	e-tron

Condition

Customer states:

- MIL on.

Workshop findings:

One or more of the following DTCs may be stored in the engine control module, J623 (address word 0001):

- **DTC P045600** (very small EVAP leak).

And/or

- **DTC P044200** (small EVAP leak).
- **DTC P04EF00** (EVAP System Very Small Leak Detected – Fresh Air Side).
- **DTC P04ED00** (EVAP system Large Leak detected – Fresh Air Side).

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

1. Check the N80 valve with the hose for leak/cracking.



Technical Service Bulletin

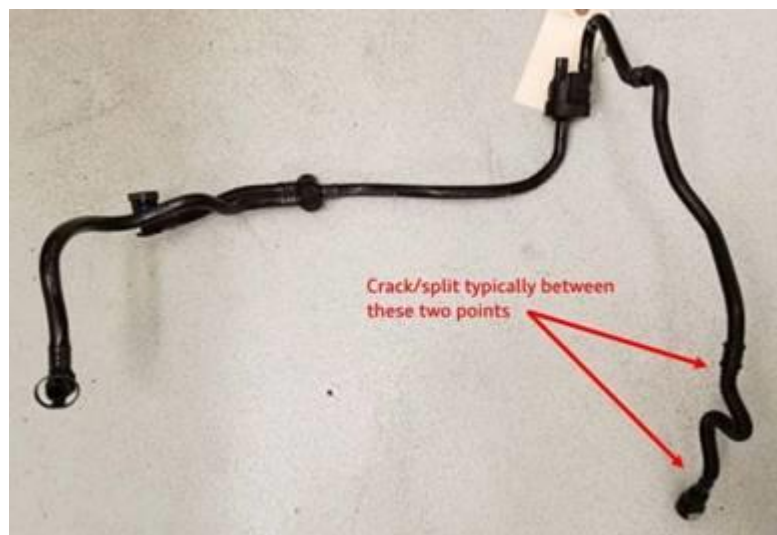


Figure 1. Potential locations of the crack.

2. If confirmed, replace the N80 assembly.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2024		
Damage Code:	0010		
Labor Operations:	ACF valve removed + reinstalled	2024 1971	See SRT
	Intake manifold	2447 1921	See SRT
Diagnostic Time:	GFF – Checking and clearing fault codes included in existing labor operations	0150 0000	Time stated on the diagnostic protocol (Max 30 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	0121 0004	10 TU



Technical Service Bulletin

Claim Comment:	As per TSB #2055592/1
-----------------------	-----------------------

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
04E133366CL	N80 assembly	01

Additional Information

All parts and service references provided in this TSB (2055592) are subject to change and/or removal.

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.