


# Latest Vehicle Concern Fixes



Restricted Performance & Dynamic Stability Control Message	19MY I-PACE
<p><b><u>Customer Voice:</u></b></p> <ul style="list-style-type: none"><li>• Restricted Performance with or without Dynamic Stability Control message on Instrument Cluster</li></ul> <p><b><u>Technical Description:</u></b></p> <ul style="list-style-type: none"><li>• This message may be paired with P0A2A, P0A2B, or P0A2D for Drive Motor “A” Temperature Sensor Circuit stored in either both or either EPIC B or C</li></ul> <p><b><u>Status:</u></b></p> <ul style="list-style-type: none"><li>• Under investigation</li><li>• Follow TOPIx &amp; Pathfinder Guided Diagnostics.</li><li>• Inspect all the connectors at the EPIC and the EDU including the HV Cables. Inspect connectors for damaged &amp; check to confirm there isn’t any coolant in the HV 3 phase connector at the EDU. Check Fuse 32 for rear inverter &amp; Fuse 17 for front inverter.</li><li>• Should parts be replaced, please raise an EPQR with the parts manager information</li></ul>	 <p>The image shows a yellow warning triangle with an exclamation mark inside, set against a dark background. Below the triangle, the text "Restricted Performance" is displayed in white.</p>

