


Latest Vehicle Concern Fixes



Automatic Emergency Braking Not Available in Instrument Pack	18MY – 20MY E-PACE, F-PACE, I-PACE, F-TYPE, XE, XF, XJ, Range Rover, RR Sport, RR Velar, RR Evoque, Discovery, Discovery Sport
<p>Customer Voice:</p> <ul style="list-style-type: none">• Automatic Emergency Braking not available• Forward Alert not available• Emergency Lane Keeping not available <p>Technical Description:</p> <ul style="list-style-type: none">• Supplier manufacturing process error resulting in faulty hardware• DTC set in IPMA “U3000-96 – Component Internal Failure” <p>Status:</p> <ul style="list-style-type: none">• Supplier Permanent Corrective Action has been completed as of April 11th 2019• Workshop Manual U3000-96 Help text will be altered to provide clear instructions to retailers• Pathfinder Guided Diagnostic DTC Help text will have an active link that will take you to TOPIX DTC Help text.	 <p>The image shows a close-up of a vehicle's instrument cluster. At the top, it displays '0 mph' and '69°F'. Below the speedometer, there is a large 'i' icon in a circle, indicating a warning. The text on the screen reads: 'OK to drive with caution Autonomous Emergency Braking not available'. At the bottom, it says 'Press OK to clear'. There are also icons for 'PARK', '3:24 PM', and a fuel gauge showing 7%.</p>

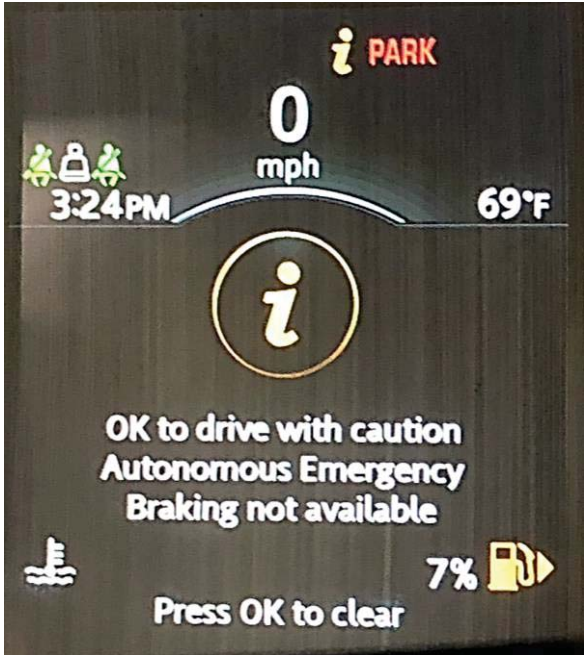