



Bulletin No.: PIT4601A
Published date: 08/14/2019

Preliminary Information

PIT4601A Wind Whistle Noise From Front Of the Vehicle at Speeds Above 55 mph

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Rainier	2006 - 2008	All	All	All	All
Chevrolet	Trailblazer Models	2006 - 2009	All	All	All	All
GMC	Envoy Models	2006 - 2009	All	All	All	All
Saab	97x	2006 - 2008	All	All	All	All

Supersession Statement

This PI was superseded to update Model Years. Please discard PIT4601.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern




Some customers may comment of a wind noise from the front of the A-pillar, either of the outside rear view mirror(s), or the front of the vehicle. Typically the noise occurs at speeds above 55mph. The source of this noise may be from the headlamp area called out as number

(1) in the image above.



Closer inspection of this area may reveal an improperly positioned front fascia in relation to the head light capsule. Refer to (2) in the image above.

Recommendations / Instructions

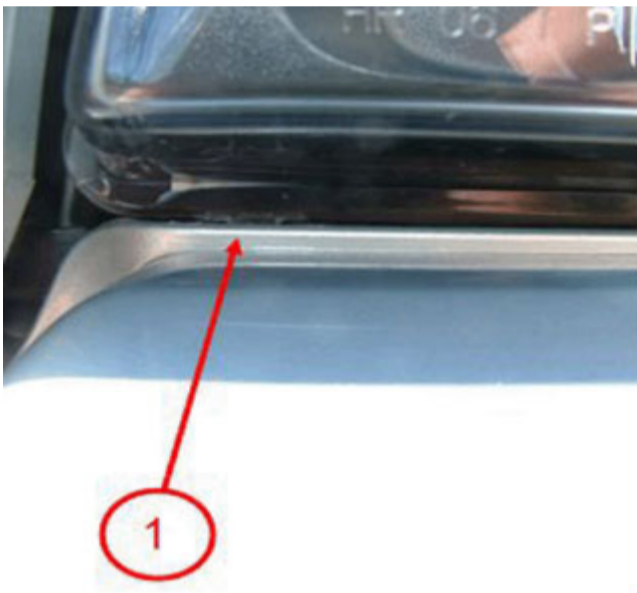

Reposition the front fascia to cover the headlight lower mounting tabs. Correct appearance shown called out as number 1 in the image above. Test drive the vehicle to be sure the vehicle was repaired.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.