



Preliminary Information

PIP5672 Malfunction Indicator Lamp MIL Illuminated Stop Start Function Not Working With Only DTC P2797 Stored

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Malibu	2019	All	All	All	MRG

Involved Region or Country	North America
Additional Options (RPO)	None
Condition	Some customers may comment that the MIL is illuminated and the stop start function is not working. Technicians may find only DTC P2797 set in the Transmission Control Module (TCM). P2797 Auxiliary Transmission Fluid Pump Performance.
Cause	This condition may be caused by an internal failure in the auxiliary fluid pump.

Correction:

Replace the auxiliary transmission pump if P2797 Auxiliary Transmission Fluid Pump Performance is the only code set.

If any other codes are set refer to SI and diagnose those codes first

Service Procedure:

Refer to: Automatic Transmission Fluid Pump Removal.

Note: To remove the pump assembly grasp the turbine shaft and remove the forward clutch and pump assembly as one piece.

Keep the clutch assembly inserted in the pump, this will protect the shaft seals and they will not need to be replaced.

Refer to Transmission Fluid Pump Disassemble for instruction for replacing the auxiliary pump .

Note: The WPC pump assembly comes with “B” seal ring, item # 162 already installed.

Parts Information

The Automatic Transmission Auxiliary Pump (Qty 1) can be obtained from the Warranty Parts Center (WPC) using the TSP Dealer Request Form located on Global Connect<Service Department<Service Forms Application<General Information tab<TSP Dealer Request Form. Instructions for submitting are on the form. Request part WPC841

Warranty Information

Labor Operation	Description	Labor Time
8463470	Transmission Fluid Pump Replacement.	Use Published Labor Time.

Version History

Version	1
Modified	08/23/2019 - Created on.



© 2019 General Motors. All Rights Reserved.