

## Reversing camera VS30 malfunctions

---

Topic number	LI54.30-N-070148
Version	1
Function group	54.30 Instrument cluster, display instruments, hazard warning device
Date	08-09-2019
Validity	BR 907 with code FR8 Reversing camera
Reason for change	
Reason for block	

---

### Complaint:

Malfunctions in the reversing camera

### Cause:

Software (item number) A2139027817 in reversing camera RVC177 control unit B84/3

### Remedy:

Ensure the following add-ons are installed on the XENTRY diagnosis unit:

- Addon 12990 for DVD0719
- Addon 12948 for DVD0519
  
- Update the reversing camera control unit or work through XENTRY according to specifications
  
- Do not replace any components

**NOTE:** If the problems persist after the update, please create a PTSS case with a note referring to the reoccurrence of the problem with new software (new software item number A0009022059)

Symptoms
Communication/information / Assistance and warning systems / Parking assist / Reversing camera / Malfunction
Communication/information / Assistance and warning systems / Parking assist / Reversing camera / Without picture

Control unit/fault code		
Control unit	Fault code	Fault text
B84/3 - Backup camera RVC177 (Code: FR8, FR7)	B21FFE4	The reversing camera has a malfunction. _
B84/3 - Backup camera RVC177 (Code: FR8, FR7)	B21FFEB	The reversing camera has a malfunction. _

# XENTRY TIPS

---

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-0990	PROGRAM CODE..... CONTROL UNITI (AFTER QUICK TEST)	0.3	82226 90	Reversing camera software release
54-1011	SHORT TEST PERFORM	0.2		
54-0650	ON-BOARD POWER SUPPLY VOLTAGE MAINTAIN	0.1		

Validity		
Vehicle	Engine	Transmission
Sprinter 907	*	*