

Latest Vehicle Concern Fixes



No Start Due To GWM	18 – 20MY Range Rover, RR Sport, RR Evoque, RR Discovery, XE, I-PACE, E-PACE
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">• Customer states the vehicle will not start. <p><u>Technical Description:</u></p> <ul style="list-style-type: none">• The door locks operate correctly but, when the start/stop button is pressed the vehicle does not start due to the GWM. <p><u>Status:</u></p> <ul style="list-style-type: none">• If the BCM/GWM is off-line, please perform a hard reset and then update the GWM software.• 18MY L494 software release on July 22nd 2019• 19MY X590, L462, L494 and L405 software released mid June 2019• 20MY L551 software release July 15th 2019• 20MY X760 software release Aug 9th 2019• 20MY X540 software release Oct 14th 2019• 18MY L462 software release late Oct 2019	

