

Solution K27240982 Thursday, August 29, 2019 9:13:11 PM CEST

** SOLUTION **

00-011011	
Title	** Tech Tip ** TT - 019 - 2015 OBD2015 HDE 11 (Model Year 2016 Truck) Injector Fault Codes P0201 To P0206 FMI 13
Mack Models	
Mack Model	LEU, LR, MRU-TerraPro, CHU-Pinnacle, Axle back, CXU-Pinnacle, Axle front, GU-Granite
Volvo Models	
Volvo Model	VN, VNL, VNM, VAH, VHD
Emission Standard	
Emission Standard	US14+OBD15
Engine family	
Engine family	11L Engine, MP7
** SOLUTION **	
Cause	Reports are being received that OBD2015 MP7 and D11 chassis built between March 1, 2015 and up to the chassis clean points indicated below are logging DTC's P0201 to P0206 FMI 13 due to the engine harness rubbing at the air compressor.

Soluti on

Brand	Engine SN	Chassis #
Mack	575954	CXU613 75556
Volvo	575976	N 936453

DTC P0201 FMI 13 to P0206 FMI 13 (Injectors 1 through 6 Open Circuit)

Othe
r possible
short circ
cuit faults
can log in
the foll
lowing comp
onents

Crank Speed sensor

Cam Speed sensor

Boost pressure sensor

EGR temp sensor

EGR differential pressure sensor

EGR valve


PreHeater sensor wire

Recommended Actions – Inspect the engine harness

Vehicle effect – MIL lamp and engine miss

Recommended Actions:

The engine harness in the air compressor area may not be supported correctly and may have made contact with the air compressor. When these faults are logging, look in this area first. Do not check under the valve cover until this area has been inspected. A service publication will be released to address this issue.

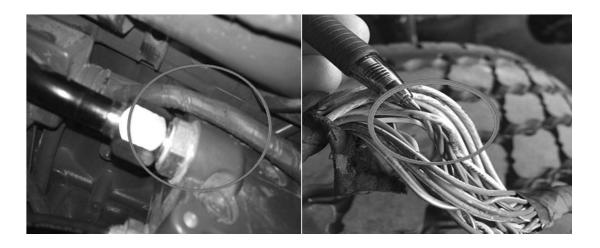

Solution visibility	Dealer distribution		
Function(s)/component(s) affected			
Function affected	1 1 0 EMS, EECU, Diagnostic tool, wiring harness		
Function Group			
Function Group	2371 Injector, 2861 Engine Wiring Harness		
Customer effect			
Main customer effect	$calibration/programming/pairing/missing\ operation\ ,\ diagnostics/methodology\ ,\ efficien\ cy/abnormal\ behavior\ ,\ fault\ code/display$		
Fault Codes And Erro	or Codes		
OBDII Diagnostic Trouble Codes (P, U, B Format)	P020113, P020213, P020313, P020413, P020513, P020613		

Conditions

Frequency of occurrence of problem	always
Administration	
Author	A241298
Last modified by	RU4469V
Creation date	16-01-2017 22:01
Date of last update	22-08-2019 16:08
Status	Published