

SERVICE BULLETIN

COPYRIGHT© NISSAN NORTH AMERICA, INC.

Classification: EM19-009 Reference:

ITB19-028

Date:

September 25, 2019

Q50 AND Q60 WITH VR30DDTT (V6) ENGINE; ENGINE OIL DRAIN PLUG SERVICE INFORMATION

APPLIED VEHICLES: 2016-2020 Q50 (V37) 2017-2020 Q60 (CV37) APPLIED ENGINE: VR30DDTT (V6)

SERVICE INFORMATION

NOTICE

Whenever installing an engine oil drain plug on an **APPLIED VEHICLE** with a VR30DDTT (V6) engine, **NEVER** tighten the drain plug greater than its specified torque. Over-tightening may loosen the threaded insert in the oil pan (lower), causing an oil leak. <u>ALWAYS</u> replace the drain plug gasket after removing the drain plug, and then tighten the drain plug to the specified torque.

- VR30DDTT (V6) engine oil drain plug torque (with new gasket):
 - > 2WD and AWD: 33.5 N•m (3.4 kg-m, 25 ft-lbs)

ACAUTION

- Avoid contact with the engine oil as it may be hot and cause burns.
- Avoid prolonged or repeated contact with used engine oil as it may cause skin cancer. Try to avoid direct skin contact with used engine oil. If skin contact is made, wash with a suitable hand cleaner or soap as soon as possible.

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
September 25, 2019	ITB19-028	Original bulletin published

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.