



**Countries:** AUSTRALIA, BRAZIL, CANADA, UNITED STATES, SOUTH AFRICA  
**Document ID:** IK0400018  
**Availability:** ISIS  
**Revision:** 3  
**Major System:** BRAKES  
**Created:** 11/15/2006  
**Current Language:** English  
**Last Modified:** 8/13/2013  
**Other Languages:** [Français](#), [Español](#),  
**Author:** Anthony Kelso  
**Viewed:** 738

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 <a href="#">View My Bookmarks</a>				 136	 231

**Title: Uneven Brake Pad Wear Between the Inner and Outer Pads on Hydraulic Brake /Pin Slide Vehicles**

**Applies To: 1000, 3000, 4000s CE 200 CE 300 built after 1/2004**

**Resolution:**

1. Check the caliper slide pins and caliper for free movement.
2. Check to ensure that the caliper slide pins are within specifications
3. Check caliper pistons for binding
4. Replace any worn pins or calipers
5. During reassembly clean the pins with non-abrasive solvents and re-lubricate with Shell Albida PPS-1 grease 2585384C1 (3 oz. tube).

**Recommended brake pads:**

On vehicles under 26,000# GVWR install the light duty lining HX-402. Use axle set part number 2508013C91 for 66 MM calipers, and axle set part number 2508014C91 for the 73 MM calipers.

For vehicles over 26,000# GVWR install the International aftermarket lining 7610. Use axle set part number ZJCMKD 786A for 66 MM calipers, and axle set part number ZJCMKD 786 for 73 MM calipers.

Hide Details

Feedback Information

Viewed: 737
Helpful: 136
Not Helpful: 231
No Feedback Found