

WKA5 Workshop campaign - Checking fill level sensor for water spray system and replacing it if necessary

Version 1

English (US)



- > Overview
- > Parts required
 - > Ordering required parts
- > Warranty processing
 - > Scope 1:
 - > Scope 2:
- > Further information

WKA5 Workshop campaign - Checking fill level sensor for water spray system and replacing it if necessary

Overview

There is a possibility that the float for the water spray system fill level sensor can stick at both the lowest and very top position due to unfavorable component tolerances on the affected vehicles.

If the float sticks at the lowest position, the warning message "Fill coolant reservoir for charge-air cooler - Visit workshop" will be displayed in the instrument cluster even though the reservoir for the water spray system is still sufficiently full.

If the float sticks at the very top position, the reservoir will subsequently become empty and no warning message will be displayed. As a result, engine power will be reduced and the pump can be damaged.

To prevent this from happening, the fill level sensor must be checked and may have to be replaced, depending on the result of the check.

Model type	911 GT2 RS (991)
Model year	2018
Manufacturing period	between 29.11.2017 and 16.10.2018
Number	616

Parts required

Part No.	Designation	Quantity/vehicle	Parts return*
00004330474	Sensor module	1	No

* The parts must be stored until such a time as the **related warranty or campaign claim has been credited** in WWS. If a **barcode is generated** with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the genuine remanufactured parts

process or be scrapped.

Ordering required parts

Parts may be ordered for appointments as needed, with no PRMS ticket required. Please refrain from over-ordering.

Warranty processing

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

Scope 1:

Damage code	WKA5 66 000 1
Working time	41 TU

Scope 2:

Damage code	WKA5 66 000 2
Working time	46 TU

Further information

Exported/imported vehicles	Carry out the campaign
Work instruction	TI No. 05/19, Group 2, Service, WKA5
Vehicle list and allocation	See Attached VIN list or PCSS
Technical Information*	PCSS

* Please find enclosed the Technical Information in the form of a PDF file. Please bear in mind that this is provided for your information only. The version published in PCSS is the definitive version.

For further information, please contact:

Ryan Cooney

Regulatory Affairs

ryan.cooney@porsche.us

[991 2 5-19 WKA5 Checking Fill Level Sensor
for Water Spray System and Replacing it if
Necessary \(Workshop Campaign\).pdf](#)

498.6 KB

(59 views)

[WKA5 VIN List.xlsx](#)

20.0 KB

(33 views)

Created by [Ryan Cooney](#) on Oct 22, 2019 10:52 PM. Last modified by [Ryan Cooney](#) on Oct 22, 2019 11:06 PM.

Categories: Workshop Campaigns, 911 Carrera

Tags : [carrera](#), [workshop](#), [991 gt2 rs](#), [year k](#), [wka5](#)

624 Views

[Report Abuse](#)

Content and Topics

Personal

Manage

Create

Your Groups >

Edit Profile >

Admin Console >

Discussion >

Your Content >

Change Password >

PPN Administration >

Files >

Your Places >

Document >

Collaboration >

Document

Blog Post >

Poll >

Message >

Event >

Photo Album >

Idea >

Space >

Group >

© 2019 Dr. Ing. h.c. F. Porsche AG. [Legal notice.](#) [Copyright.](#) [Terms of use.](#) [Privacy Policy.](#) [Cookie Policy.](#) [009](#)