

Passenger-side wiper arm strikes vent grille of water collector

Topic number	LI82.30-P-058874
Version	1
Design group	82.30 Windshield wipers
Date	04-10-2014
Validity	X204 as of 03.02.2014 up to 2049XXXG308033
Reason for change	
Reason for block	

Complaint:

Passenger-side wiper arm strikes vent grille of water collector (Figure 1).

Attachments	
File	Designation
Bild 1.jpg	Collision of passenger-side wiper arm with vent grille of water collector

Cause:

Passenger-side wiper arm set too low.

Remedy:

Loosen wiper arm, adjust by 1-2 teeth and retighten.

For correct setting see Figure 2: A - Marking on windshield, a = 21 mm

Note:

With the implementation of the new wiper system from February 2014, the wiper arm must be positioned further up due to the modified geometry, otherwise it collides with the vent grille of the water collector.

Attachments	
File	Designation
Bild 2.JPG	Rest position of blade tip of passenger-side wiper arm 21 mm above marking

Symptoms
Overall vehicle / Cleaning system / Windscreen wiper / Strikes

Validity		
Vehicle	Engine	Transmission
GLK (204)	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
204.901	651.916	711.653
204.901	651.916	722.908
204.901	651.916	722.996
204.902	651.916	711.653
204.902	651.916	716.658
204.902	651.916	722.908
204.904	651.912	722.965
204.934	274.920	722.995
204.936	274.920	711.653
204.936	274.920	722.995
204.937	274.920	722.968
204.956	272.991	722.906
204.957	276.957	722.906
204.981	272.948	722.964
204.982	651.912	722.965
204.983	642.961	722.962
204.984	651.912	722.965
204.987	272.971	722.960
204.988	276.957	722.960
204.990	276.957	722.960
204.992	642.832	722.962
204.993	642.835	722.966
204.997	651.912	722.965

Attachments

Bild 1.jpg:



Bild 2.JPG:

