Steering column clicking or cracking noise

Topic number LI46.10-N-058722

Version 1

Design group 46.10 Steering wheel, casing tube, steering shaft, stee-

ring lock

Date 03-14-2014

Validity Model 906 with code (XM0) Facelift

Reason for change Reason for block

Complaint:

Steering column clicking or cracking noise.

Cause:

Steering column bearings (see Figure 01).

Attachments	
File	Designation
01.JPG	Steering column bearing

Remedy:

Do not replace any parts.

After a certain time or running-in period (approx. 650 miles, depending on operating conditions), the shape of the tolerance ring adapts itself to the movements of the inner bearing race and the noise disappears.

Symptoms

Chassis/suspension / Steering system / Steering noise / Cracking

Validity		
Vehicle	Engine	Transmission
Sprinter III	*	*

Attachments

01.JPG:

