

Model series 246/176/117 center stowa- ge compartment closes/opens with difficulty

Topic number	LI68.20-P-058749
Version	1
Design group	68.20 Center console
Date	03-18-2014
Validity	Model series 246/176/117 up to production date 30.6.2013 only with automatic transmission (code 429)
Reason for change	
Reason for block	

Complaint:

The center stowage compartment does not close or open smoothly.

Cause:

The kinematics of the guide rail for the lid jams.

Remedy:

Replace operating lever/ guide rail:

Remove stowage compartment (ar.6820 -p-2420nkb)

Remove operating lever/ guide rail at side (see picture).

Install new operating lever/ guide rail (A176 766 00 00) in the reverse order.

Attachments	
File	Designation
Ausbau Betätigungshebel - Führungsschiene A176 766 00 00.jpg	Work procedure for removal of operating lever/ guide rail (A176 766 00 00)

Symptoms
Body / Interior equipment / Interior trim / Bad fitting
Body / Interior equipment / Stowage box/tray / Warped/twisted/distorted

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 176 766 00 00			Operating lever/ guide rail	1		X	

WIS-References			
Document number	Title	Note	Allocation
AR68.20-p-2420NKB	Remove stowage compartment or ashtray housing		Remedy

Validity		
Vehicle	Engine	Transmission
*	*	724
117.301	*	*
117.303	*	*
117.312	*	*
117.342	*	*
117.343	*	*
117.344	*	*
117.346	*	*
117.352	*	*
242.848	*	*
246.200	*	*
246.201	*	*
246.203	*	*
246.207	*	*
246.211	*	*
246.212	*	*
246.242	*	*
246.243	*	*
246.244	*	*
246.247	*	*
A (176)	*	*

Attachments

Ausbau Betätigungshebel - Führungsschiene
A176 766 00 00.jpg:

