

**** SOLUTION ****

Title	Volvo Chassis - PTO Switch Installation For Vehicles With Updated Interior - Model Year 2018 And Newer
-------	---

Volvo Models

Volvo Model	VNL , VNM , VNR , VNX , VAH , VHD
--------------------	-----------------------------------

Emission Standard

Emission Standard	US17 , US17+OBD18
-------------------	-------------------

Engine family

Engine family	11L Engine , 13L Engine
---------------	-------------------------

**** SOLUTION ****


Cause	Installation instructions to wire in a PTO switch for Volvo trucks with a modular harness.
-------	--




Solution**Tools and Materials**

- 1 roll of 18 gauge wire
- 2 - 978304 terminals for VECU
- 1 - 21046482 PTO switch connector
- 5 - 20864152 terminals for switch connector
- 4 - 8086231 terminals. 2-for FRC, 1 for SK141A, 1 for SKX03FA
- 1 - 20737026 terminals for MCTR connector
- 1 - 22542588 PTO switch

- Crimp jaw tool #88890233

Instructions

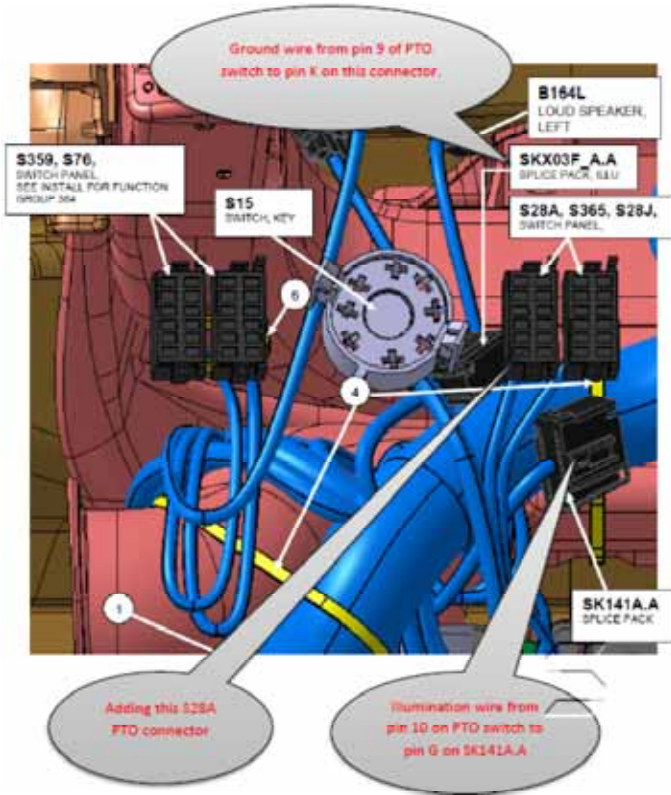

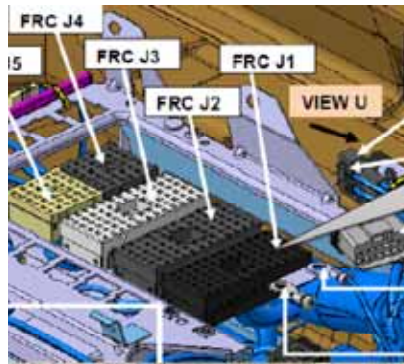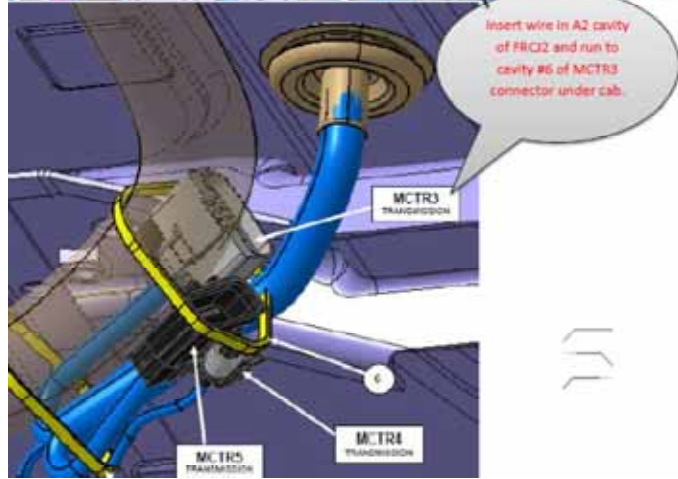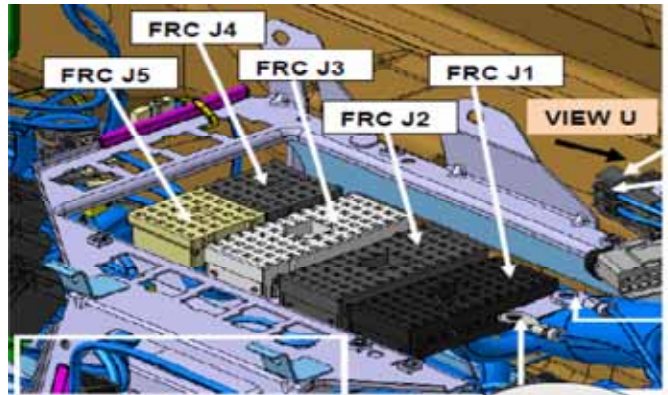

When switch installation is complete, run Accessory Kit #85137335.

NOTE: Program the VECU only on Type F AMTs

Solution visibility	Dealer distribution
---------------------	---------------------

Function(s)/component(s) affected

Function affected	electricity , PTO
-------------------	-------------------

Function Group

Function Group	483 control power take-off
----------------	----------------------------

Customer effect

Main customer effect	calibration/programming/pairing/missing operation , diagnostics/methodology
----------------------	---

Conditions

Vehicle operating mode	with a PTO
------------------------	------------

Administration

Author	RU4469V
--------	---------

Dealer ID	RU4469V
-----------	---------

Last modified by	A241298
------------------	---------

Creation date	28-09-2018 22:09
---------------	------------------

Date of last update	04-11-2019 19:11
---------------------	------------------

Status	Published
--------	-----------

UNCONTROLLED COPY. Printed document is for temporary use only and should not be retained.