

WKJ1 - Replacing Fuel Tank Cap (Workshop Campaign)

Vehicle Type: **Cayenne S E-Hybrid (92A)**

Model Year: **As of 2015 up to 2018**

Subject: **Fuel tank cap**

Information: **There is a possibility that the sealing ring on the fuel tank cap will be pressed out of the sealing seat under certain conditions on the affected vehicles.**

If this happens, fuel vapor can escape from the fuel tank. The customer may get a smell of fuel and might hear a hissing noise in the fuel tank cap area.

Remedial Action: Replace fuel tank cap.

Affected Vehicles: There are 6,847 vehicles affected in North America. Only vehicles assigned to the campaign (see also PCSS Vehicles).


Parts Required

Parts Info:	Part No.	Designation	Qty.
	992201550B	⇒ Fuel tank cap	1 ea.

Replace Fuel Tank Cap


Work Procedure: 1 Replace fuel tank cap ⇒ *Fuel tank cap-1-*.

1.1 Open the filler flap.

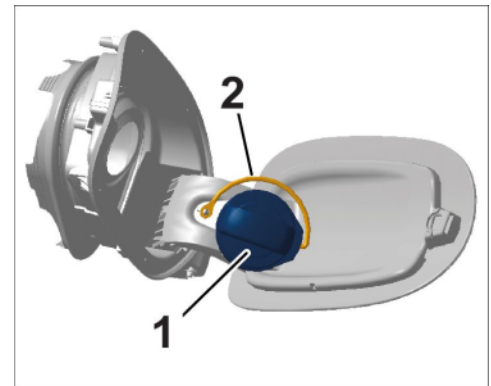

Fuel tank cap

- 1.2 Carefully pull the retaining strap ⇒ *Removing retaining strap for fuel tank cap -1-* down ⇒ *Removing retaining strap for fuel tank cap -arrow a-* and then guide it up over the retaining pivot ⇒ *Removing retaining strap for fuel tank cap -arrow b-* and remove it.

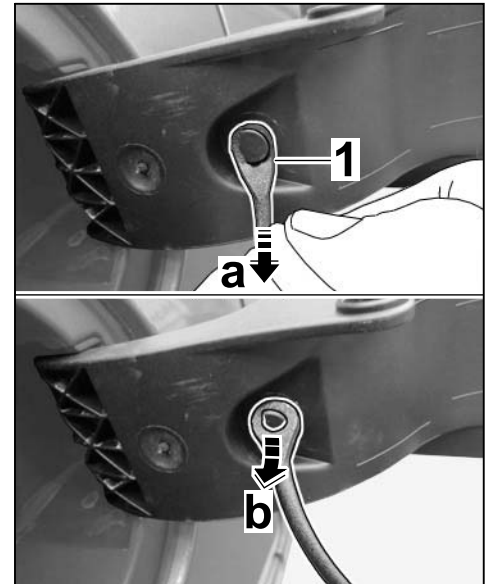


Removing retaining strap for fuel tank cap

⚠ WARNING

Flammable or explosive materials

- **Danger of fire or explosion**
- ⇒ **Avoid contact with hot parts or sources of ignition.**
- ⇒ **Use suction to remove ignitable vapors.**
- ⇒ **Attach warning sign in a clearly visible position.**

- 1.3 Carefully unscrew and remove fuel tank cap.
- 1.4 Fit new fuel tank cap on the filler neck and screw it on until it engages securely with an audible click.
- 1.5 Position retaining strap ⇒ *Attaching retaining strap for fuel tank cap -1-* on the retaining pivot ⇒ *Attaching retaining strap for fuel tank cap -2-*, pull it down carefully ⇒ *Attaching retaining strap for fuel tank cap -arrow-* and guide it over the retaining pivot.
- 1.6 Close the filler flap and press on the rear of the filler flap until it engages securely.
- 2 Enter the campaign in the Warranty and Maintenance booklet.

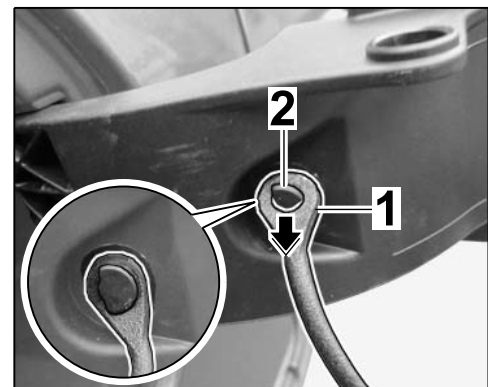

Attaching retaining strap for fuel tank cap

Warranty Processing

Scope 1:

Working time:	
Replacing fuel tank cap	Labor time: 10 TU
Parts required:	
992201550B Fuel tank cap	1 ea.
⇒ Damage Code WKJ1 066 000 2	

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

©2019 Porsche Cars North America, Inc.