



SERVICE BULLETIN

Classification: BT19-015	Reference: NTB19-102	Date: November 14, 2019
-----------------------------	-------------------------	----------------------------

2017-2019 TITAN/TITAN XD KING CAB; WIND NOISE AT 40 MPH AND ABOVE

APPLIED VEHICLES:	2017-2019 Titan (A61) 2017-2019 Titan XD (A61)
APPLIED BODY	King Cab
APPLIED VIN:	2017-2018 Titan/Titan XD: All 2019 Titan/Titan XD: Built before 1N6(*)A1C(**)KN530308
APPLIED DATE:	2017-2018 Titan/Titan XD: All 2019 Titan/Titan XD: Built before September 4, 2019

IF YOU CONFIRM

A wind noise coming from the front door area that has the following characteristics:

- Occurs at 40 mph and above.
- The wind noise is heard from the left and/or right side of the vehicle.
- The wind noise may be heard near the rear edge of the front door window or near the front edge of the rear door window.

ACTION

Replace the sash moldings on both sides of the vehicle with the parts listed in **PARTS INFORMATION** on the last page of this bulletin.

IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Verify the wind noise is originating from the area circled in Figure 1.
 - Left side is shown, right side is a mirror image.

HINT:

The wind noise may be present on one side or both sides of the vehicle.



Figure 1

2. Partially remove the rear door weatherstrip (Figure 2).
 - Left side is shown, right side is a mirror image.
3. Release the three (3) sash molding clips, indicated with a yellow triangle in Figure 2 and remove the sash molding.
4. Replace the sash molding with the new one listed in **PARTS INFORMATION** on the next page.
5. Reattach the rear door weatherstrip.
6. Repeat steps 2 through step 5 for the right side of the vehicle.

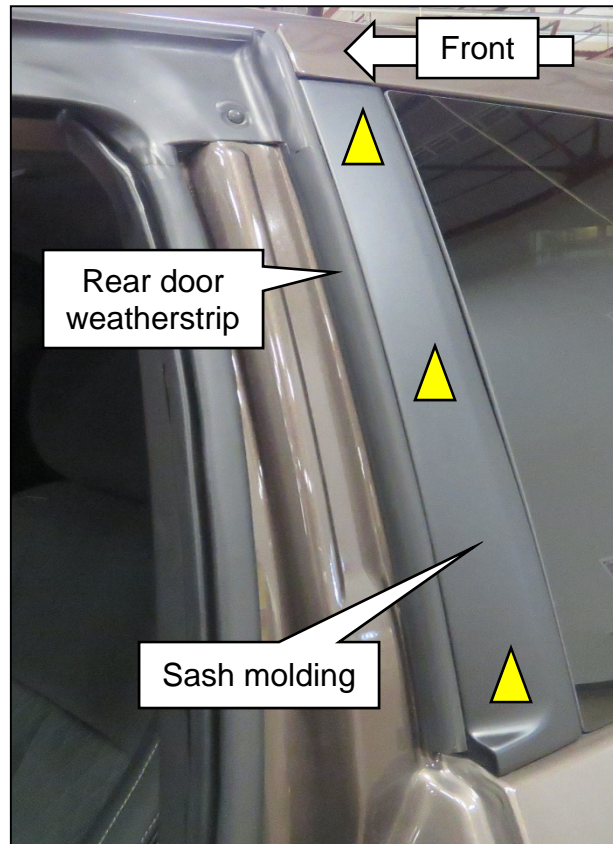


Figure 2

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Sash Molding LH	82287-EZ10D	1
Sash Molding RH	82286-EZ10D	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Door Sash Molding	(1)	UK18AA	ZE	32	(2)

- (1) Reference the electronic parts catalog and use the appropriate Sash Molding as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated Flat Rate Time (FRT).

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
November 14, 2019	NTB19-102	Original bulletin published

