

MPD UPDATE

Powertrain



P0234-77 Turbocharger Under boost with a Restricted Performance Message		16-18MY equipped with 3.0L TDV6
<p><u>Problem Description:</u></p> <ul style="list-style-type: none"> - TDV6 16-18MYMY3.0L TDV6 equipped vehicles have a MIL and “Restricted Performance” on the instrument cluster and P0234-77 stored in the PCM <p><u>Current Status:</u></p> <ul style="list-style-type: none"> - Under Investigation <p><u>Recommended Actions:</u></p> <ul style="list-style-type: none"> - Follow LT01204, if applicable. If P0234-77 is still stored or the DPF will not regenerate, check if the soot levels decrease. P0234-77 inhibits regeneration. If the DPF cannot be regenerated during a drive or PATHFINDER procedure, raise a Technical Assistance case for further instruction. Should LTS instruct you to replace the DPF, please raise an EPQR. 		
KPI's		
Total VIN Count	Status	Issue Owner
		Elyse McArthur

Solution Unavailable or project not yet accepted

Solution known, not yet delivered

Service Fix Available, Communication Published

