



Preliminary Information

PIT3254B SIR Light Illuminated and DTC B1001 Stored In The SDM Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Rainier	2004 - 2008	All	All	All	All
Chevrolet	Trailblazer	2002 - 2009	All	All	All	All
Chevrolet	Trailblazer EXT	2002 - 2009	All	All	All	All
Chevrolet	Trailblazer SS	2002 - 2009	All	All	All	All
GMC	Envoy	2002 - 2009	All	All	All	All
GMC	Envoy XL	2002 - 2009	All	All	All	All
GMC	Envoy EXV	2002 - 2009	All	All	All	All
GMC	Envoy Denali	2002 - 2009	All	All	All	All
Oldsmobile	Bravada	2002 - 2004	All	All	All	All
Saab	97x	2005 - 2006	All	All	All	All

Supersession Statement

This PI was superseded to update Model Years. Please discard PIT3254A.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

B1001 stored in the SDM. This is most common when a BCM or SDM is replaced in service.

Recommendations / Instructions

Follow the Procedures listed below:

- 1. Use Tech 2 scan tool**
- 2. Build vehicle year and body**
- 3. Select body section**
- 4. Select BCM**
- 5. Select Special Functions**
- 6. Set up SDM serial number in the BCM.**
- 7. Select BCM SETUP soft key.**
- 8. Clear all history codes.**

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS