

Solution K23884537 Wednesday, December 4, 2019 9:45:00 PM CET

** SOLUTION **

" SOLUTION "	
Title	Diagnostic Trouble Code (DTC) P04DB - Crankcase Ventilation Disconnected; US10+OBD13 To US14+OBD16 Emissions (Non-Common Rail Fuel System), Common Model Years 2014 To 2017
Mack Models	
Mack Model	LEU, LR, MRU-TerraPro, CHU-Pinnacle, Axle back, CXU-Pinnacle, Axle front, GU-Granite, TD-Titan
Emission Standard	
Emission Standard	US10+OBD13, US14+OBD13, US14+OBD15, US14+OBD16
Engine family	
Engine family	MP7, MP8, MP10
** SOLUTION **	
Cause	No fault found (NFF) when diagnosing Diagnostic Trouble Code (DTC) P04DB - Crankcase Ventilation Disconnected with Premium Tech Tool (PTT)
Solution	If Tech Tool concludes no fault found for DTC P04DB Crankcase Ventilation: Disconnected Pipe/Separator Monitor, verify that there are absolutely no leaks around the crankcase vent elbow, valve cover connection, or tube connection at the CCV housing. The integrity of the flex portion of the oil fill tube and the seal for the oil level dipstick should be verified.
Solution visibility	Dealer distribution
Function(s)/compone	nt(s) affected
Function affected	Engine
Function Group	
Function Group	257 crankcase ventilation
Customer effect	
Main customer effect	fault code/display
Fault Codes And Erro	r Codes
OBDII Diagnostic Trouble Codes (P, U, B Format)	POWERTRAIN, P04DB-00
Administration	
Author	a175606
Last modified by	RU4469V
Creation date	24-03-2016 16:03
Date of last update	26-11-2019 21:11

	Status	Published
	Average score	0
	Number of scores	1
INCONTROLLER CORV District Language in formation and an allocations are allocations and an allocations are allocations and an allocations are allocations are allocations are allocations are allocations are allocations are allocations.		

UNCONTROLLED COPY. Printed document is for temporary use only and should not be retained.