

GPOP - Issue Review System

Part Number: 68237953A\$, 68280607A\$, 68237158A\$, 68311130A\$, 68249962A\$

Part Description: LATCH, Hood

Issue Description: For the following concerns, please verify secondary plunger switch before replacing hood latch with primary switch. Please refer to service information for complete diagnostics of the secondary plunger switch which is located in the left front under hood on RU, MP, and WK/WD and left rear under hood on KL.

- 1) Electronic Stop Start Message on Cluster or DTC P152F without hood ajar illuminated.
- 2) KL Hood ajar light is on or unlatched hood due to high closing effort.
(KL hood may have a higher closing effort to latch the hood as rubber bumper interference is set purposely high to prevent hood flutter at highway speeds)

If stop start message or DTC P152F is present on vehicles without a hood ajar light illuminated, the issue is not related to the primary hood latch switch.

~ _____ ~
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
