

Service Bulletin

Bulletin No.: 17-NA-216

Date: November, 2019


TECHNICAL

Subject: Convertible Top Back Glass Separation from Top Cover Material

Brand:	Model:	Model Year:		Date Breakpoint:		Engine:	Transmission:
		from	to	from	to	Engine.	Transmission.
Buick	Cascada	2016	2019				
Chevrolet	Camaro Convertible	2016	2018			All	All

Involved Region or Country	North America, Europe, Middle East, Israel, South America, Japan
	Some customers may comment on seeing the back glass separating from the convertible top cover material. Several examples of the separation are shown in the graphic examples below:
Condition 1	
	479466

479466

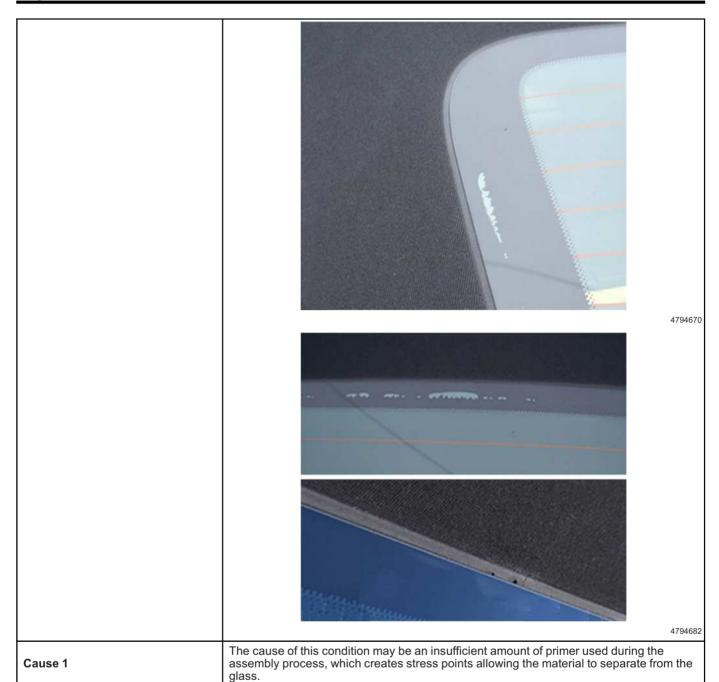

Condition 2 5049793 Some customers may comment that the vehicle may exhibit a condition where the back glass is separating from the top. This condition will typically start in the corner of the back glass. Cause 2 The cause of this condition may be the back glass separating from the bond. Correction 4794112 It will be necessary to replace the convertible top cover (1). Refer to Folding Top Cover Replacement in SI.

Parts Information

Causal Part	Description	Vehicle	Part Number	Qty
Х	COVER ASM-F/TOP (Kalahari - 21T)		84078048	1
Х	COVER ASM-F/TOP (Black - 19T)	Camaro	84078049	1
Х	COVER ASM-F/TOP (Blue - 00T)		84078050	1
Х	COVER, F/TOP (BLACK)		13426145	1
Х	COVER, F/TOP (MALBEC)	Cascada	13426146	1
Х	COVER, F/TOP (SWEET MOKKA)		13426147	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
6011360	Folding Top Cover Replacement	Use Published Labor Operation Time

Version	4
Modified	Released June 30, 2017 April 30, 2018 – Updated the Date Breakpoint and added Condition #2. February 04, 2019 – Added the 2018 Model Year. November 18, 2019 – Removed breakpoint dates in Conditions, added the Cascada Model, updated the Involved Region or Country section and added the Cascada parts required to the Parts Information.