

MBUX multimedia system (CONNECT907) : ESP menu not visible in central display

Topic number	LI82.60-N-070784
Version	1
Function group	82.60 Radio, audio, video systems
Date	01-21-2020
Validity	Model 907 with code E3M-E1E (MBUX 7-inch without navigation) up to FIN N001897; P005545 (up to and including manufacturing date 3rd May 2018)
Reason for change	Title and validity updated.
Reason for block	

Complaint:

ESP menu not visible in central display

Cause:

Faulty coding of "Connect907" control unit (A26/17)

Note: The faulty coding only causes a display error. All ESP functions are available without limitation.

Remedy:

Perform SCN coding of "Connect907" control unit (A26/17)

Attachments	
File	Description
ESP-Menu_en.JPG	ESP menu available

Symptoms
Communication/information / Information display / Displays / Multifunction display / Multifunction display, menu / Menu items missing
Communication/information / Information display / Displays / Multifunction display / Multifunction display, menu / Incomplete display

Control unit/fault code		
Control unit	Fault code	Fault text
A26/17 - MBUX multimedia system CONNECT907 (Code: E1A)	-	-

XENTRY TIPS

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-0992	CODE CONTROL UNIT A26/17 (AFTER QUICK TEST)	0.1	82501 52	Radio does not operate correctly
54-0650	ON BOARD POWER SUPPLY VOLTAGE MAINTAIN	0.1		
54-1011	PERFORM QUICK TEST	0.2		

Validity		
Vehicle	Engine	Transmission
Sprinter 907	*	*

Attachments

ESP-Menu_en.JPG:

