



Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Applicable Vehicles

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, GTI, Golf R, eGolf, Golf SportWagen	2015-2018	All	All	All	All
Atlas, Tiguan LWB	2018	All	All	All	All

Revision Table

Instance Number	Published Date	Version Number	Reason For Update
2058951/1	3/13/2020	90-20-01TT	Original publication.

Technical Background

When switching the vehicle OFF there may be an error in the instrument cluster **-KX2-** stating to place the vehicle in park, when the vehicle is already in park. The door locks will also not lock. There may not be any fault codes present.

Service

- Check the GFF log to see if there is coding present in address word 16.

If the GFF log displays all zeros:

- Run the control module software configuration for address word 16, or code manually through OBD using an old GFF log to get the correct coding.

If the GFF log does not display all zeros:

- Follow normal diagnostic protocol.

Additional Information

© 2020 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.