



Technical Service Bulletin

17 MIL on, DTC P2279 and/or P0507 whistling noises from engine compartment

17 20 99 2040644/11 March 19, 2020. Supersedes Technical Service Bulletin Group 17 number 18-93 dated March 28, 2018 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, and A8	2013 - 2016	All	4.0 TFSI

Condition

REVISION HISTORY		
Revision	Date	Purpose
11	-	Revised <i>Warranty</i> (Updated TU)
10	03/28/2018	Revised title Revised <i>Warranty</i> (Updated GFF Diagnostic Time)
9	11/21/2017	Revised <i>Required Parts and Tools</i> (Updated quantity)

Customer states:

- A metallic whistling or grinding sound is heard from the engine compartment when the vehicle is at idle speed.
- The sound usually only occurs when the engine is warm.
- The MIL is sporadically on.

Workshop findings:

The following DTCs are stored in the engine control module (ECM), J623 (address word 0001):

- **DTC P2279** (Intake air system leak).
- **DTC P0507** (Idle control system rpm higher than expected).

Technical Background

A leak in the crankcase breather module (pressure regulating valve) can cause this condition.

Production Solution

A fabric-reinforced internal membrane of the crankcase breather module.



Technical Service Bulletin

Service

1. Perform both of the following checks before proceeding:
 - Compare the sound of the vehicle to the sound in the video located at:
<https://audi-external.kzoplatform.com:443/swf/player/311> (Figure 1).
 - Open the filler cap to check whether the sound is affected when the filler cap is open.



Figure 1. QR code for viewing the video with a QR code reader on phones and tablets. Alternatively, the video can be accessed through computer internet browsers at the link provided in this bulletin.

2. If the sound of the vehicle matches the sound in the video **and** the sound is affected when the filler cap is opened, replace the oil separator breather module.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	1726		
Damage Code:	0050		
Labor Operations:	For A8 and S8:		
	Oil separator breather remove +reinstall	1753 1971	See SRT
	Air intake distributor remove + reinstall	2446 1921	See SRT
	For S6 and S7:		
	Oil separator breather remove + reinstall	1753 1971	See SRT
	Air intake distributor remove + reinstall	2446 1921	See SRT



Technical Service Bulletin

	Additional labor for adjustment of ACC, top view camera, and night vision, if necessary based on vehicle equipment	See Elsa	See Elsa
	For RS 7:		
	Oil separator breather remove +reinstall	1753 1971	See SRT
	Refrigerant drain + fill	8703 1750	See SRT
	Air intake distributor remove + reinstall	2446 1923	See SRT
	Additional labor for adjustment of ACC, top view camera, and night vision, if necessary based on vehicle equipment	See Elsa	See Elsa
Diagnostic Time:	GFF – Checking and clearing fault codes included in existing labor operations	0150 0000	Time stated on the diagnostic protocol (Max 150 TU, depending on vehicle options)
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2040644/11		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
079103542E	Oil separator	01
079129717J	Gasket intercooler left	01
079129717K	Gasket intercooler right	01
N 90442501	Retaining clip	02



Technical Service Bulletin

N 90489801	Retaining clip	02
N 90409501	Retaining clip	02
079145818	Gasket throttle body	01
079145417B	Gasket recirculation valve	02
WHT 001011	O-ring	01
G 013A8J1G	Coolant additive	01
Outside material	Distilled water (obtain locally)	Shop supply
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA

Additional Information

All parts and service references provided in this TSB (2040644) are subject to change and/or removal.

©2020 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.