

GPOP - Issue Review System

Part Number: 04861714A\$, 04861727A\$, 05281418A\$, 05281225A\$, 53032868A\$, 68208213A\$, 52124785A\$, 04581697A\$, 04581652A\$, 04891585A\$

Part Description: PEDAL, Accelerator

Issue Description: Before replacing accelerator pedal, be sure to follow fault code diagnostic procedures in Service Library and be sure to check wiring and connectors.

P2122 and P2127 will set if accelerator pedal connector is disconnected during diagnosis. Make sure codes are active before replacing pedal.

DTC P2299 is usually caused by a two footed driver and accelerator pedal should not be replaced for this fault if driving style is confirmed with the customer.

~ _____ ~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
