

# ADDITIONAL ROCKET 3 PDI & SERVICE CARE POINT



## Notice Information

Ref	14204
Posted Date:	
Posted To:	General Manager / Business Owner, Technician, Aftersales Manager, Service Leader / Advisor, Accounts / Admin
Subject:	Service/Technical


**TOL NOTICE (US&CAN) – March 19, 2020**

**TOL Ref. # 14204-SVC**

## Additional Rocket 3 PDI & Service Care Point

Triumph has identified an additional care point for all Rocket 3 model PDIs and first (600 mile/1,000 km) service inspections. The upper and lower yoke pinch bolts are required to be checked and – if necessary – re-torqued as specified in the service manual.

Tighten both left-side and right-side the upper yoke pinch bolts to **25 Nm**:

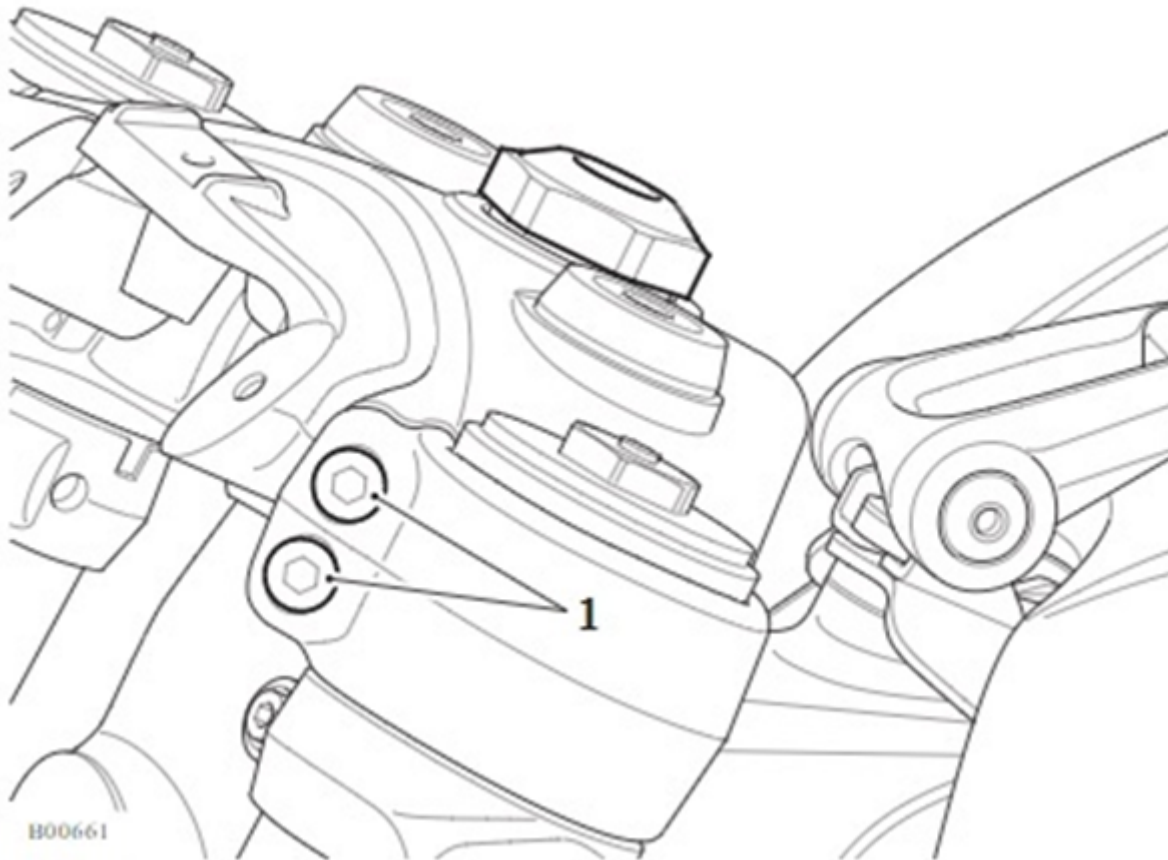

**1. Upper yoke pinch bolts**


Tighten both left-side and right-side lower yoke pinch bolts in the following two stages:

### Stage 1

Tighten the fixings to **25 Nm** in the sequence shown below (top first, then middle, then bottom):

### Stage 2

Re-tighten the fixings to **25 Nm** in the sequence shown below (top first, then middle, then bottom):

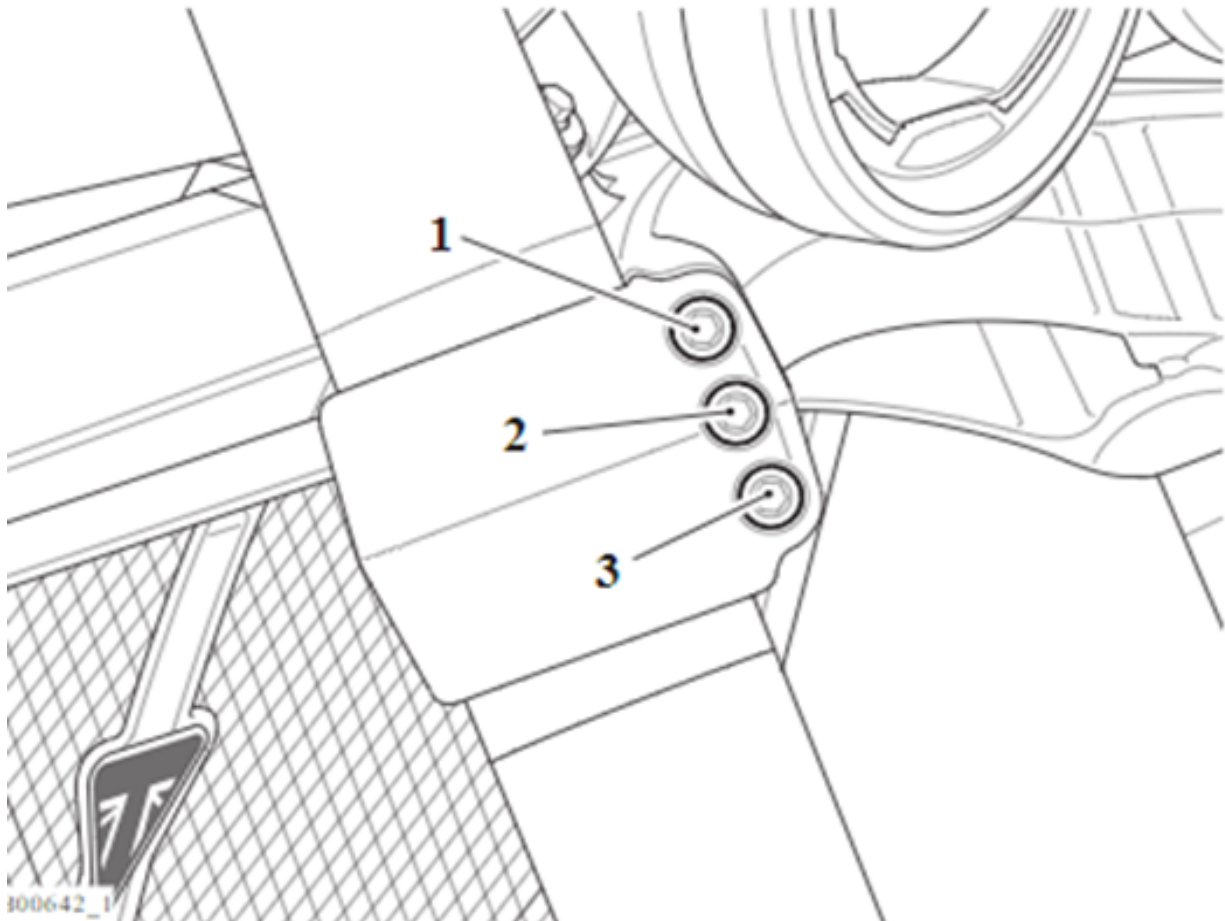

**1,2,3. Lower yoke pinch bolts**

If you have any additional questions, please contact Triumph Customer & Dealer Support at (888) 284-6288.