

2020-03-02



SIB 51 07 20

UNINTENDED HATCH ACTIVATION AFTER CONVERSION

MODEL

E-Series	Model Description	Production Date
G01	X3 Sports Activity Vehicle	Up to November, 2019
G02	X4 Sports Activity Coupe	Up to November, 2019

SITUATION

The hatch may unintentionally open.

Note: This bulletin only affects the above model vehicles which previously had the Conversion, opening of tailgate only possible after unlocking (activation required in the vehicle menu) that is outlined in [SI B51 30 16](#) completed.

CAUSE

The key buttons may require too little pressure, causing an accidental opening of the rear hatch when stationary.

CORRECTION

Replace both keys. Replacement keys are improved and share the same part number. The pressure required to activate a button is increased.

PROCEDURE

Replace both keys.

Reference REP 66 12... "Teach in radio remote control/radio remote control with display (BMW Display key) for instructions on teaching in replacement remotes.

PARTS INFORMATION

Obtain and confirm the part numbers for your specific vehicle by entering the chassis number in either ETK or AIR which considers specific equipment and/or options.

Part Number	Description	Quantity
Refer to ETK/AIR	Radio remote control	2

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	6135621400	Radio remote control/key fob transmitter (ID transmitter), basic, no display temporary malfunction
Labor Operation	Description	Labor Allowance
00 00 006	Performing vehicle test (with vehicle diagnosis system – checking faults) (Main work)	Refer to AIR
Or:		
00 00 556	Performing vehicle test (with vehicle diagnosis system – checking faults) (Plus work)	Refer to AIR
And:		
61 21 528	Connect an approved battery charger/power supply (indicated in AIR as Charging battery)	Refer to AIR
And:		

66 12 610	Replacing radio remote control	Refer to AIR
-----------	--------------------------------	--------------