



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-20-15

Subject: Software Version Update, Enhancements and Fixes

Date: Apr. 29, 2020

Supersedes VOS-20-14 due to new diagnostic content.

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V5.2.7	Diagnostic Content: V2.40.2

Key Fixes/Enhancements for Diagnostic Content: V2.40.2:

1. 7P - Touareg 2010 – 2017, CATA 3.0 L TDI-CR 165kW

VAG00193: Right rear exterior door handle touch sensor

G418_7P_58____1_0210_11_Sensor_hinten_rechts_00011 voltage check of the right rear sensor.

- Test states the voltage at the harness connector is OK if it matches the battery voltage. But component is PWM.

2. A3 - Passat/New Midsize Sedan 2011 – 2017, CVCA 2.0l TDI SCR / 110 kW

P13D800: Sensor for internal pressure of cylinder 4 Short circuit to ground

GXXX_5C_23_CKRA_1_1110_11_Brennraumdruckgeber_00011 control module communication error: The value Maximal_cylinder_pressure_cylinder_# for the request parameter Record Data Identifier could not be entered.

3. CA/CM Atlas 2018 – 2020

C113B00: Hill descent control button

E618_X_1_0918_11_Taster_Bergabfahrassistent_ContiMK100_00000 states to disconnect the connectors at the ABS Control Module - J104 and Hill Descent Control Button - E618.

- Hill Descent Control Button - E618 is integrated into the infotainment screen.

4. BW - Tiguan 2018 – 2020

P25AC00: Piston Cooling Oil Control Circuit Performance/Stuck Off and P052400: Engine Oil Pressure Too Low SYS_X_1_0715_11_X_X_SMG_OT_FSB_Schmierung_00000 test malfunction.

- Program malfunction. No data was transferred. Please send feedback.

5. General translation errors.



Service Information
