

Bulletin No.: PIT5667A Published date: 04/16/2020

Preliminary Information

PIT5667A Diagnostic Aid: C0460 Stored after Service

<u>Models</u>

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:		
			from	to	Engine:			
Buick	Envision	2017 - 2020	All	All	All	All		
Involved Region or Country:		North America	North America					
Condition:		C0460 stored after service.						
Cause:		Loss of volatile memory.						

Correction:

If the battery is disconnected for service this code will set current. After service is completed it is necessary to either turnthe steering wheel from lock to lock with the engine running or to drive th vehicle in a straight line to allow the PSCM re zero the SAS. If the intermediate steering shaft ha been removed for service and this code will not clearverify the shaft is properly indexed when installed. This may become a bulletin as more information becomes available.

Version History

Version	2		
	03/29/2019 - Created on		
Created	04/15/2020 - Added 2020 Model Year.		



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.