



Preliminary Information

PIP5724 SES Lamp With Camshaft or Oil Pump System Related DTCs


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2020	All	All	6.2L, L86	All
Chevrolet	Camaro	2020	All	All	6.2L, LT1, LT4	All
Chevrolet	Silverado 1500 (New Model)	2020	All	All	5.3L 6.2L L84, L87	All
Chevrolet	Suburban	2020	All	All	5.3L L83 6.2L, L86	All
Chevrolet	Tahoe	2020	All	All	5.3L L83 6.2L L86	All
GMC	Sierra 1500 (New Model)	2020	All	All	5.3L 6.2L L84, L87	All
GMC	Yukon Models	2020	All	All	5.3L, 6.2L, L83, L86	All

Involved Region or Country	North America
Condition	The vehicle may have an SES lamp with any of the following DTC P06DA, P06DB, P06DC, P250A, P0300, P0340, P0341, P0335, P0336, P0641, P0011, P0010, P2088, P2089, and/or P2230. Possible crank no start or a stall.
Cause	Possible wiring jumper harness pinched between the X154 connector bracket and the front engine cover on lower left side of the engine.

Correction:

Inspect for the wiring harness being pinched under the bracket on the location below.

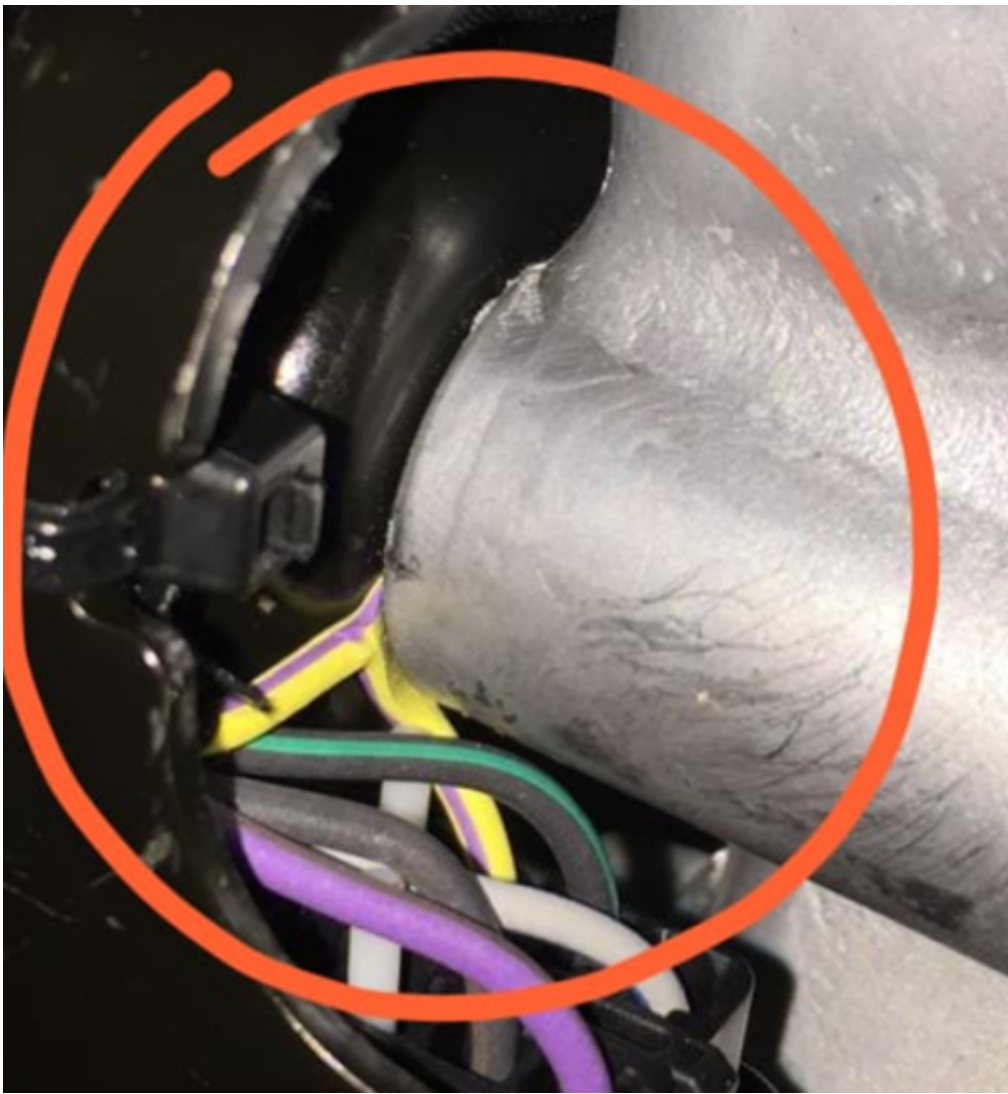

Warranty Information

The correction for this concern may be one of several repairs. For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair.

Version History

Version	1
Modified	04/21/2020 - Created on.



© 2020 General Motors. All Rights Reserved.