

## STAR ONLINE PUBLICATION

---

**Case Number:** S1808000175

**Release Date:** 3/28/2020

**Symptom/Vehicle Issue:** LED Front Fog Lamps Flicker Or Intermittently Light, Are Dim Or Inoperative. A U11E9, or B16FB-15 may be set

**Diagnosis:** The customer may complain the front LED fog lamps flicker, intermittently light, are dim or inoperative. Upon scanning the vehicles for DTC you may find U11E9 or B16FB-15. Inspect the fog lamp connectors verifying the connectors are fully seated and engaged. To verify, disengage and re-engage the female side of the fog lamp connector.

It is also advised to inspect the fascia connector for water intrusion and corrosion. Clean, replace and repair as necessary.

**Repair Procedure:** If the fog lamps still do not light and/or flicker. Verify power and ground going to the fog lamp connector. If no issues are found, replace the fog lamp.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**