



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-20-17

Subject: Software Version Update, Enhancements and Fixes

Date: May 28, 2020

Supersedes VOS-20-15 due to new diagnostic content.

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V5.2.7	Diagnostic Content: V2.40.3

Key Fixes/Enhancements for Diagnostic Content: V2.40.3:

1. 16 - Jetta 2011 – 2018, CVCA 2.0I TDI SCR / 110 kW.

B103F1B: Outside temperature sensor Resistance too G17__16_90___1_0508_66_UDS_00066 test malfunction.

- The open and short circuit status reported at the temperature sensor or the wiring test is incorrect

2. BU - Jetta 2018 – 2020

EVAP emission tank leak test SYS_X_1_0816_11_X_X_TDK_FSB_00000 test states to block the hose line and remove the tank ventilation valve N80, beat the valve on a white sheet of paper.

- The hoses on either side of the N80 valve cannot be removed and the 1.4L engine N80 valve has a plastic hosing integrated on both sides.

3. BU - Jetta 2018 – 2020

P218100: Cooling System Performance SYS_X_1_0816_11_X_X_KSY_OT_HP_00000 Log book evaluation program malfunction DTC P2D8C00P2B8700. Please send feedback. Program is continued.

4. AU - Golf 2013 – 2020

P00AF00: Turbocharger/Supercharger Boost Control "A" Module Performance SYS_X_1_0615_11_X_X_LUA_O_FSB_00011 test malfunction.

(cont.)



Service Information

- The measuring value could not be read.

Turbocharger_1_bank_1_turbine_inlet_bypass_actuator_position_counter_started_jam_off_trial (TL Losreissversuche) - Send feedback once test has ended.

5. 3H - Arteon 2018 – 2020

C111454: Lane change assistance control module No basic setting

J769_X_1_0414_11_SG_SWA_UDS_00000 and lane assistance calibration

J769_X_1_0414_11_Kalibrierung_SWA_UDS_00000 test malfunction.

- Lane change assistant system identification does not identify the installed variant.

6. 3H - Arteon 2018 – 2020

Lane change assistance control module replacement test J769_X_1_0514_11_SG_ersetzen_00000 test malfunction.

- The test provides a variant list in numeric range of 1 – 6 to select from. However, test provides only “YES” or “NO” buttons for the option selection. Variant selection is not possible.

7. General translation errors.