

SSM 48790- 2020 Explorer/Aviator/Police Interceptor Utility Hybrid - 10R80 MHT - Transmission Fluid Leak - Less Than 100 Miles

Some 2020 Explorer/Aviator/Police Interceptor Utility vehicles equipped with a 10R80 MHT automatic transmission and with less than 100 miles may exhibit a transmission fluid leak that appears to be coming from between the hybrid drive unit and transmission case joint. This condition may be due to residual transmission fluid trapped between the front module and transmission case joint during the assembly process. Recommend cleaning the area thoroughly and reevaluating with the vehicle at operating temperature before attempting any leak related repairs.