



Technical Service Bulletin

90 Top view camera image: only the park aid lines are displayed

90 20 48 2048517/3 May 21, 2020. Supersedes Technical Service Bulletin Group 90 number 18-00 dated October 2, 2018 for reasons listed below.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------------|-------------|-----------|---|
| Q5 | 2018 - 2020 | All | With front and rear view camera system and two side cameras |
| A4, A5, and Q7 | 2017 - 2019 | All | With front and rear view camera system and two side cameras |

Condition

| REVISION HISTORY | | |
|------------------|------------|---|
| Revision | Date | Purpose |
| 3 | - | Revised header (Added MY 19/20) Revised <i>Condition</i> (Changed PSS to the corresponding TSB) Revised <i>Service</i> (Corrected the software version number in the table) Revised <i>Additional Information</i> (Updated with TSB) |
| 2 | 10/02/2018 | Revised <i>Condition</i> (Added Note) Revised <i>Warranty</i> (Updated Labor Operation) Revised <i>Additional Information</i> (Added PSS) |
| 1 | 07/31/2017 | Initial publication |



Technical Service Bulletin

Customer states:

- The video feed from the exterior of the vehicle is not shown (Figure 1). Only the static outlines of the park aid are being displayed.



Figure 1. Only static lines are displayed.

Note:

For model year 2018 vehicles:

- If a camera picture is displayed and only the right display tile reverts to graphic mode, please refer to TSB 2053028: *91 Top view camera setting changes to graphic view intermittently after startup.*

Technical Background

The software needs to be updated.


Production Solution

New software in the overhead view camera module, J928 (address word 006C).

Service

SVM Update Instructions

1. Follow all instructions in the attached TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the overhead view camera module, J928 (address word 006C) using the SVM action code as listed in the table below if necessary.
3. Perform calibration of the overhead view camera system as outlined in the Elsa Repair Manual.

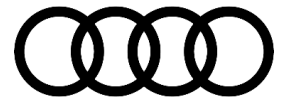

Technical Service Bulletin

| Diagnostic Address | Old Software Part Number | Old Software Version | New Software Part Number | New Software Version (or higher) | SVM Code Input |
|--------------------|--------------------------|----------------------|--------------------------|----------------------------------|----------------|
| 006C | 4M0907428 | * | 4M0907428F | 0318 | 6CA004 |
| | 4M0907428A | | | | |
| | 4M0907428B | | | | |
| | 4M0907428C | | | | |
| | 4M0907428D | | | | |
| | 4M0907428E | | | | |
| | 4M0907428F | | | | |

Warranty

| | | | |
|--------------------------|---|--------------|---|
| Claim Type: | <ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | |
| Service Number: | 9084 | | |
| Damage Code: | 0039 | | |
| Labor Operations: | Overhead view camera adjust | 9083 1500 | See SRT |
| Diagnostic Time: | GFF (Software update) | 0150 0000 | Time stated on the diagnostic protocol (Max 100 TU) |
| | Road test prior to service procedure | No allowance | 0 TU |
| | Road test after service procedure | No allowance | 0 TU |
| Claim Comment: | As per TSB #2048517/3 | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2053028, *91 Top view camera setting changes to graphic view intermittently after startup.*
- TSB 2011732, *00 Software Version Management (SVM), operating instructions.*

All parts and service references provided in this TSB (2048517) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.