



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-20-20

Subject: Software Version Update, Enhancements and Fixes

Date: June 12, 2020

Supersedes VOS-20-17 due to new diagnostic content.

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V5.2.7	Diagnostic Content: V2.40.4

Key Fixes/Enhancements for Diagnostic Content: V2.40.4:

1. AU - Golf 2013 – 2020

ECM DTC P011100: Intake Air Temperature Sensor 1 Bank 1 Circuit Range/Performance
SYS_X_1_0419_11_x_x_FSK_LUA_Ansauglufttemperaturgeber_FS_00000 ends abruptly after stating
to "Leave the connector disconnected for the following test."

- Test only states to repair malfunction and ends.

2. AU - Golf 2013 – 2020

No test plan created for ECM fault code P062800: Fuel Pump "A" Control Circuit Low.

3. CA/CM Atlas 2018 – 2020

Readiness test SYS_J623_1_0816_11_X_X_MSG_OT_SOD_ReadinessCodeErzeugen_00000 ends
and states that the vehicle is equipped with NVLD = Natural Vacuum Leak Detection system.

- Vehicle is equipped with DMTL = Diagnostic Module Tank-Leakage system with a DCGA 2.0I
TFS engine.

4. 16 - Jetta 2011 – 2018, CBPA 2.0 L Motronic / 85kW

ECM DTC P0321: Ign./Distributor Eng.Speed Inp.Circ. Range/Performance
G28__16_24CBPA_1_1209_66_00066 wiring test calls out an incorrect ECM pin numbers.

- The correct Engine Speed (RPM) Sensor -G28 wiring test pin numbers on the ECM are
T60/40, T60/51 and T60/52.



Service Information

5. CA/CM Atlas 2018 – 2020

Control module address -0075- fault B105213: Cell phone prep. ctrl. head/emergency call module open circuit calls out test E508_5G_1_0514_11_Pruefen_00000 for Cellular Telephone Preparation Control Head -E508.

- Vehicle is equipped with E734 telematics button module as shown in the wiring and connector diagrams.

6. 16 - Jetta 2011 – 2018, CZTA 1.4l Motronic / 110 kW

ECM DTC P056E00: cold start turbocharger/supercharger boost control "A" performance test SYS_X_1_0615_11_X_X_LUA_O_FSB_00011 is inconclusive.

- Test only performs visual inspection of components, ends with "The cause of the malfunction cannot be further localized with Guided Fault Finding" and does not provide any next steps to conclude test.

7. CA/CM Atlas 2018 – 2020

ECM DTC P16C600: Heater support pump Dry run SYS_X_1_0816_11_X_X_KSY_OT_HP_00000 Log book evaluation program malfunction. DTC: 0. Please, send feedback. Program is continued.

8. BW - Tiguan 2018 – 2020

ECM DTC P00B700: Engine Coolant Flow Low/Performance SYS_X_1_0816_11_X_X_KSY_OT_HP_00000 Log book evaluation program malfunction. DTC: 0. Please, send feedback. Program is continued.

9. 16 - Jetta 2011 – 2018, CZTA 1.4l Motronic / 110 kW

P045600: EVAP Emission Contr. Sys. (very small Leak) Leak Detected SYS_X_1_0816_11_X_X_TDK_FSB_00000 test malfunction. Test ends with the following: Test step Leak Detection Pump - V144: The basic setting was not completed successfully.

10. General translation errors.