

## Latest Vehicle Concern Fixes

### POWERTRAIN



#### Vehicle Stops Charging After 18 Hours

#### 20MY Range Rover & RR Sport PHEV

##### Customer Voice:

- Vehicle does not fully charge on a Level 1, 110v charger.

##### Technical Description:

- Vehicles built currently have an 18 hour time limit in the software for charging. This may cause a condition where the vehicle is connected to a charger for longer than 18 hours, but does not charge completely to 100% SOC. This condition may be exacerbated by cold ambient conditions and using a 120V charge cable which require a longer amount of time to fully charge the battery.

##### Status:

- PCM Calibration will change to increase 18 hour timing.
- Should you have a customer with this concern, please advise them to use a Level 2, 240V charger until the revised calibration is available.
- Software is expect to be available on PATHFINDER 22-May

