



55-18-01TT Rear Lid Does Not Operate or Does Not Operate Correctly

Release date: 07/03/2020

## Condition

**ATTENTION:**

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.  
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

### Applicable Vehicles

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas, Cross Sport	2018-2020	All	All	All	All

### Revision Table

Instance Number	Published Date	Version Number	Reason For Update
2052612/3	7/3/20	55-18-01TT	Updated to include M.Y. 2020.
2052612/2	10/19/18	TT 55-18-01	Instruction to check luggage compartment lamp part number.
2052612/1	10/5/18	TT 55-18-01	Original publication.

## Technical Background

The rear lid will not electrically open all of the way or may not electrically move at all. Trunk lamps may be inoperative. Also, interior lamps may not operate when opening the doors or may work after opening and closing the door several times. There may not be any stored faults.

## Service

Begin by unplugging the trunk lamps and retesting rear lid operation.




## 55-18-01TT Rear Lid Does Not Operate or Does Not Operate Correctly

Release date: 07/03/2020

If the lid now operates properly:

- Check the luggage compartment lamp part number by VIN in ETKA

Atlas Luggage Compartment Light



reflector					
24	1X0 947 419 A	reflector			2

luggage compartment light					
26	6L0 947 415	light	clear glass		2
27	N 017 753 5	bulb "Longlife"	5W		2

Lighting for drinks holder (CUP holder)

30		light fibre optic	see illustration, item: <a href="#">852.926.15</a>		
31	3CH 919 063	LED module			2
32	1J0 973 332	flat contact housing			1

LED module w/ fibre opt. cable dashboard

33	3CH 947 095 B	LED module w/ fibre opt. cable	drivers side	D	1
			>> - 15.01.2018		
34	3CH 947 096 B	LED module w/ fibre opt. cable	passenger side	D	1
			>> - 15.01.2018		

As a test:

- Unplug the lamps and retest operation.

If operation is restored:

- If the incorrect parts installed, replace with the correct parts for the vehicle.

If the issue is still present:

- Check the MVB for the lid lock motor in the **-J519-**.

If not reading correctly:

- Check wiring and replace the lock motor as needed.

If the MVB read correctly but the condition still exists:

- Monitor MVB for the rear lid motor sensors in **-J605-**, if sensors reads implausible or doesn't match current rear lid position, check wiring and connectors and repair as needed.

If all tests pass and a source is not found, suspect a rear lid lock.

## Additional Information

© 2020 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.