



Technical Service Bulletin

90 Instrument cluster: Permanent chime from Audi virtual cockpit after a cancelled emergency assist event

90 20 59 2058750/2 July 15, 2020. Supersedes Technical Service Bulletin Group 90 number 20-42 dated March 6, 2020 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, A8, Q7, Q8, and Audi e-tron quattro	2020	All	Audi virtual cockpit with lane assist

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Updated to new software) Revised <i>Required Parts and Tools</i> (Updated to new software)
1	03/06/2020	Initial publication

Customer states:

- After cancelling an emergency assist event, a continuous chime is triggered in the Audi virtual cockpit.

Technical Background

A software bug in the instrument cluster causes the chime to go off.

Production Solution

Optimized software in the Audi virtual cockpit introduced in current series production.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2056558: *MIB2+: Software Update Instructions*.



Tip: The vehicle key has to be located above the key reader area for the duration of this update.



Technical Service Bulletin

2. Update the instrument cluster control module, J285 (address word 0017) using the SVM action code as listed in the table below, if necessary:



Tip: For the Audi e-tron quattro, the vehicle's high-voltage battery must not be charged during this update. Please only charge the 12V battery!

Model	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SD Card	SVM Code Input
A6, A7, A8, Q7, and Q8	4K0920790B		4K0920790B		4K0906961AG	FPKWW0211
	4K0920794B		4K0920794B			
	4K0920890B	0207	4K0920890B			
	4K0920894B	0208	4K0920894B	0211		
	4K0920790B	0209	4K0920790B			
	4K0920794B	0210	4K0920794B			
	4K0920890B		4K0920890B			
	4K0920894B		4K0920894B			
Audi e-tron quattro	4KE920795A	0104 0105	4KE920795A	0108	4N0906961AM	FPKWW0211

Warranty

Claim Type:	<ul style="list-style-type: none"> 110 up to 48 Months/50,000 Miles. G10 for CPO Covered Vehicles – Verify Owner. If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9025		
Damage Code:	0039		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 75 TU)



Technical Service Bulletin

Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2058750/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Model	SD Card	Quantity
4N0906961AM	SD Update Medium (Audi e-tron quattro only)	01 (Shop tool)
4K0906961AG	SD Update Medium	01 (Shop tool)

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2056558, *MIB2+ Software Update Instructions*.

All part and service references provided in this TSB (2058750) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.