


Latest Vehicle Concern Fixes

POWERTRAIN



Hybrid System Warning- Power Supply Distribution Box	19/20MY I-PACE
<p>Customer Voice:</p> <ul style="list-style-type: none">• There is a “Hybrid System Malfunction” warning on the instrument cluster <p>Technical Description:</p> <ul style="list-style-type: none">• B1479-72 is stored in the GWM for PSDB-Actuator Stuck Open <p>Status:</p> <ul style="list-style-type: none">• Follow TOPIx & PATHFINDER Guided Diagnostics for guidance• Check the PSDB for electrical concerns (short circuit, open circuit, high resistance)• Clear the DTC & lock the vehicle & wait 2 minutes. Unlock the vehicle and retest. If the fault persists follow TOPIx steps.• Should a replacement PSDB be necessary, please raise an EPQR with the part number of the original PSDB and your parts manager mailing information. Engineering is still looking to get parts back for analysis	 A technical line drawing of the Power Supply Distribution Box (PSDB) component. It shows a rectangular base with various electrical terminals, connectors, and internal components like relays and fuses. The drawing is a perspective view from the top and side.

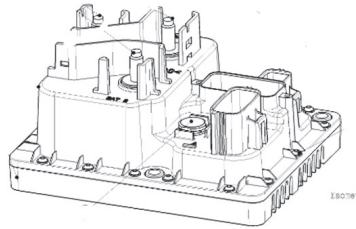