


Latest Vehicle Concern Fixes

POWERTRAIN



High Voltage Modules Missing VINs	20MY Range Rover, RR Sport PHEV, 19-20MY I-PACE
<p><u>Technical Description:</u></p> <ul style="list-style-type: none">This may cause various high voltage system concerns or disruption in system operation <p><u>Status:</u></p> <ul style="list-style-type: none">Prior to raising a TA for support on any high voltage system concern, please ensure that the VIN is written to the following modules in PATHFINDER.<ul style="list-style-type: none">TCMATCMEPICEPIC DPCMIn order to write the VIN, please select "Program as New" when flashing the module.If symptoms persist, please continue to diagnose as per TOPIx diagnosis and raise a TA if it is deemed necessary.If no TA is raised, please raise an EPQR as engineering is looking to gather more information on additional cases	<p>PATHFINDER </p> <p>JOIN THE JOURNEY</p>

