

Latest Vehicle Concern Fixes

POWERTRAIN



Coolant Leak

18MY Onward F-PACE, XE, RR
Velar equipped with AJ20P4

Customer Voice:

- The low coolant warning is on in the car.
- There is a leak under the front of the car.

Technical Description:

- The leak is identified from JX73 8C362 AC

Status:

- We are interested in gathering additional data from a vehicle **before** the hose is replaced.
- If a leak is identified from this hose or one of the connections complete the steps below with the original pipe installed:
 - Pressure test cooling system as per TOPIx when coolant temp cold.
 - Drive the vehicle for at least 20 minutes to allow the coolant to get to full operating temperature.
 - Pressure test cooling system as per TOPIx with coolant temp hot.
 - Collect pictures or videos of a leak from either side of the pipe referenced.
 - Remove hose and measure inner and outer diameter of pipe and mating surface at 90 degree intervals.
- Create an EPQR and include details of the findings from the steps provided.

