



Bulletin No.: PIT5751

Published date: N/A


## Preliminary Information

### PIT5751 SES MIL DTC P0201/P0202/P0203/P0204/P0205/P0206/P0216 (Inspect Engine Harness 3.0L Diesel)

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500	2020	All	All	3.0L LM2	All
GMC	Sierra 1500	2020	All	A	3.0L LM2	All

Involved Region or Country	North America
Condition	<p>Some customers may comment on any of the following concerns:</p> <ul style="list-style-type: none"><li>- Engine runs rough</li><li>- Misfires</li><li>- Low Power</li><li>- SES MIL</li><li>- DTC's: P0201, P0202, P0203, P0204, P0205, P0206, and/or P0216</li></ul>
Cause	<p>These concerns could be caused by the following:</p> <ul style="list-style-type: none"><li>- The engine harness getting pinched or shorted in grid coordinates H-7, shown below.</li><li>- Poor terminal contact at connector X160 callout 25, shown below.</li></ul>

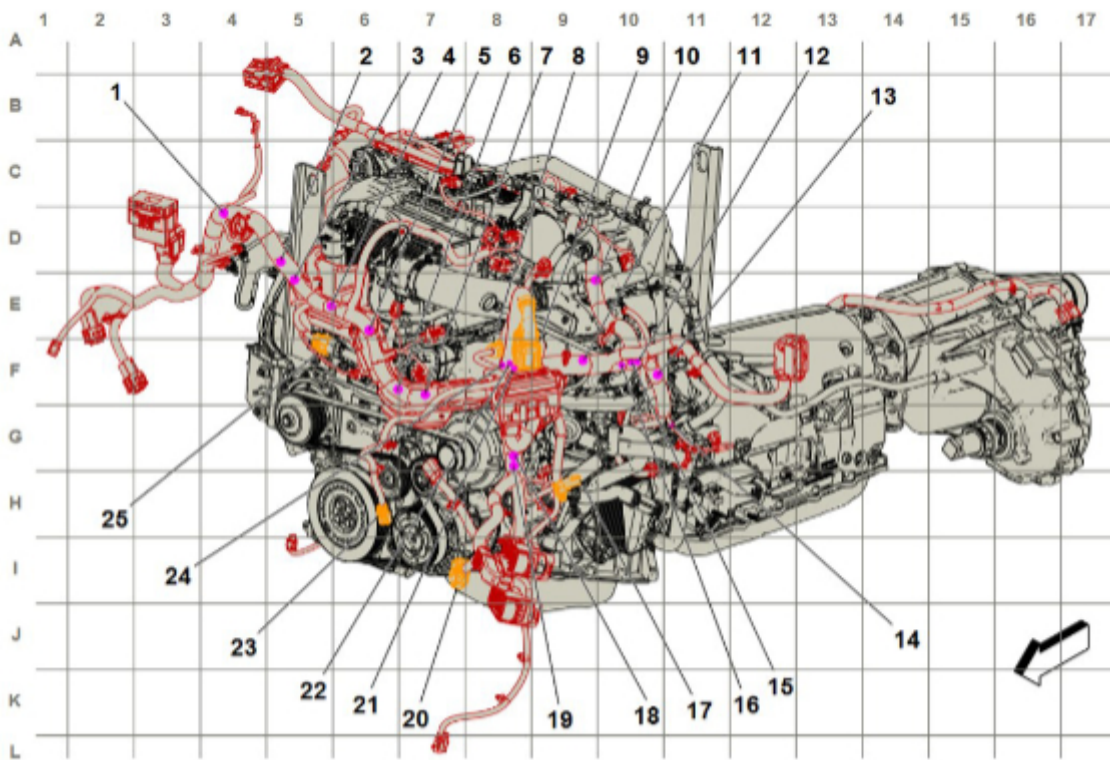

### Correction

In many cases, the ECM has been unnecessarily replaced for these concerns. Please thoroughly inspect the areas shown above and follow published SI diagnostics before any parts are replaced. If any concerns are found, then follow SI Wiring and Connector repair instructions to correct the concern.

### Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

### Version History

Version	1
Modified	06/12/2020 - Created on



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.