

STAR ONLINE PUBLICATION

Case Number: S2008000112

Release Date: 07/31/2020

Symptom/Vehicle Issue: MIL Lamp On Setting DTC's P0441, P0456, P0457, P0440

Customer Complaint/ Technician Observation: Owner complains intermittently the MIL (Malfunction Indicator Lamp) comes on in the cluster. Technician observed the stored DTC's relating to the emission control evaporative system, P0441 Evaporative System Performance, P0440 General Evaporative System Failure along with leak detected faults P0457 Loose Fuel Cap, P0456 Small Leak Detected.

Repair Procedure: Inspect connector XY465A for any signs of spread or pushed out terminals, secure the connector and terminals as needed, no parts required.



This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found