



# Technical Service Bulletin

---

## 01 MIL on, DTC P244000 stored in the ECM

01 20 79 2058095/2 August 20, 2020. Supersedes Technical Service Bulletin Group 01 number 19-40 dated December 18, 2019 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, A3 Cabriolet	2019	All	2.0 liter
A3, A3 Cabriolet	2020	000001 - 007205	2.0 liter

## Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Corrected Elsa display issue)
1	12/18/2019	Initial publication

### Customer states:

- MIL on.

### Workshop findings:

The following DTC may be stored in the engine control module (ECM), J623 (address word 0001):

- **DTC P244000** (Secondary Air Injection System Switching Valve Stuck Open Bank1) with symptom code 21423 or 7657.

## Technical Background

The optimized software will correct the above condition.

## Production Solution

Optimized software introduced in September of 2019.



# Technical Service Bulletin

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the ECM, J623 (address word 0001) using the SVM action code as listed in the table below, if necessary:

Model	Engine	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A3 and A3 Cabriolet	CZRA	8V0907115J	0003	8V0907115J	0004	01A262

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• 1E1 up to 8 Years/80,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	2470		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Software Update (Includes time for checking DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 50 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB #2058095/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

---

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (2058095) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.