

# AfterSales Diagnostic sheet

---



**MAS002247**  
(BOL 20-06)

From: Aftersales - TSO  
To: Maserati Network  
Auburn Hills, MI | August 11, 2020

## Spontaneous wiper activation

**NOTE:** The below in depth diagnostic procedures are to be used along with the procedures listed in the Workshop Manuals if a more comprehensive diagnosis is required.

**Important:** A BOL must be opened prior to removal of any parts (components). Please remember to attach pictures/ videos showing in detail the issue.

**Issue:** Spontaneous wiper activation

**Models::** M157/M156/M161

**Issue description:** Wiper activated spontaneously and ESC light ON

**Conditions:**

- KIN in RUN position
- While cranking/starting
- While driving

**DTC:**

- No DTCs in SCCM
- Lost Communication with SCCM unit set in other ECU's (e.g. C21200, C12100)

### **Troubleshooting:**

Provide responses to following questions:

- 1) Is it possible to reproduce the Customer's complaint (CC)?
- 2) When did the CC occur?:
  - 2.1) key ON-engine OFF?
  - 2.2) during engine cranking?
  - 2.3) while driving?
- 3) With the engine running, is it possible to delete the DTC?  
If yes, does the functionality of the system return to normal?

Suggested checks:

- 1) Perform battery Pico test and provide the results
- 2) By following electrical schematic FE0440 in the Workshop Manual:
  - 2.1) Measure the voltage on pins 3-4 of the SCCM connector (if possible back probe the connector without disconnecting it).

NOTE: The SCCM connector -> I001 for M156, M157 and K003 for M161

- 2.2) Check that the SCCM is properly connected to front C-can star connector;
- 3) Measure the resistance on pin 1-2 of SCCM, with the battery disconnected
- 4) If the complaint can be reproduced:
  - 4.1) Disconnect SCCM connector;
  - 4.2) Re-connect SCCM connector;
  - 4.3) Verify if the complaint appears again (please perform a video while doing this operation by turning the steering wheel to the left and right end stroke).

### **Considerations:**

If at the end of point 4.3 the issue still occurs, the SCCM unit has to be replaced. Please attach all of the above test results to the BOL as a "Help Request" in order to get the replacement authorization.